



## STAR ONLINE PUBLICATION




**Case Number:** S2208000076

**Release Date:** March 2022

**Symptom/Vehicle Issue:** Cluster Lamp Out Message, Front Parking Lamp Or Fog Lamp Left Or Right Inoperative, Ambient Air Temperature Inaccurate Or Can C BUS DTC's

**Technician Observation:** Technician observed a front fog lamp or parking lamp on the left or right not illuminating and/or ambient air temperature inaccuracy complaint. The vehicle may set any of the following DTC's **P0073 AMBIENT AIR TEMPERATURE SENSOR CIRCUIT HIGH, P0070-15AMBIENT AIR TEMPERATURE SENSOR CIRCUIT-CIRCUIT SHORT TO BATTERY OR OPEN, P0672, U110E-LOST AMBIENT TEMPERATURE MESSAGE.**

**Repair Procedure:** Inspect the black 16-way connector XY101A for any signs of corrosion and or water entry. Clean, seal and secure the connector as needed to complete. Repair kits are available for dash side full **Repair Kit:** 68497543AB, Fascia Front side full **Repair Kit:** 68500834AA.

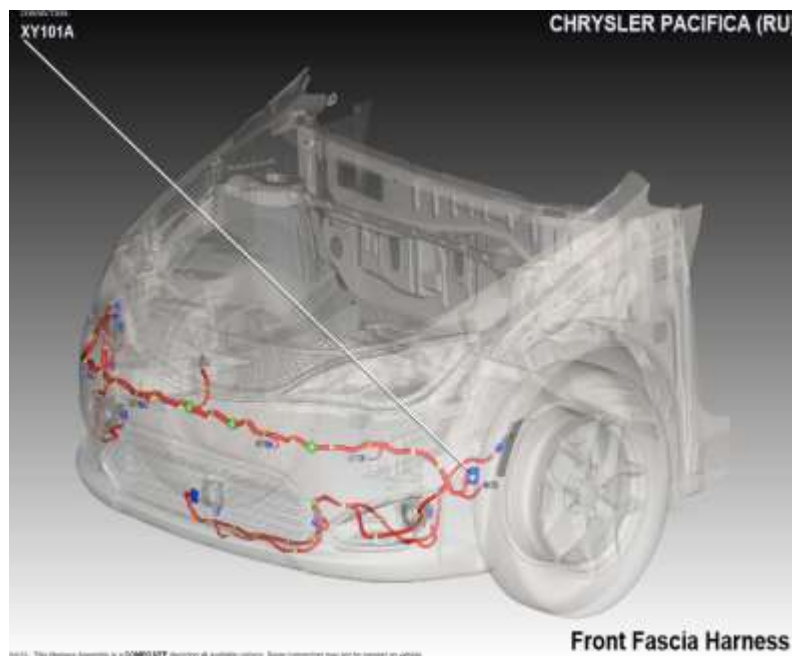

**Fig 1**

This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

**Contact STAR Center, or your Technical Assistance Center Via TechCONNECT or eCONTACT ticket if no solution is found**