



## STAR ONLINE PUBLICATION




**Case Number:** S2208000113

**Release Date:** August 2022

**Symptom/Vehicle Issue:** No Start, DTC P0615 Starter Control Circuit Open

**Discussion:** Inspect the harness routing at the engine support bracket near the starter motor as highlighted. Examine the harness at this location for any signs of harness to bracket chaffing or pinching. Repair any harness/circuit damage per the harness/circuit repair guidelines in service library. Isolate the harness contact area to ensure no further contact as needed.

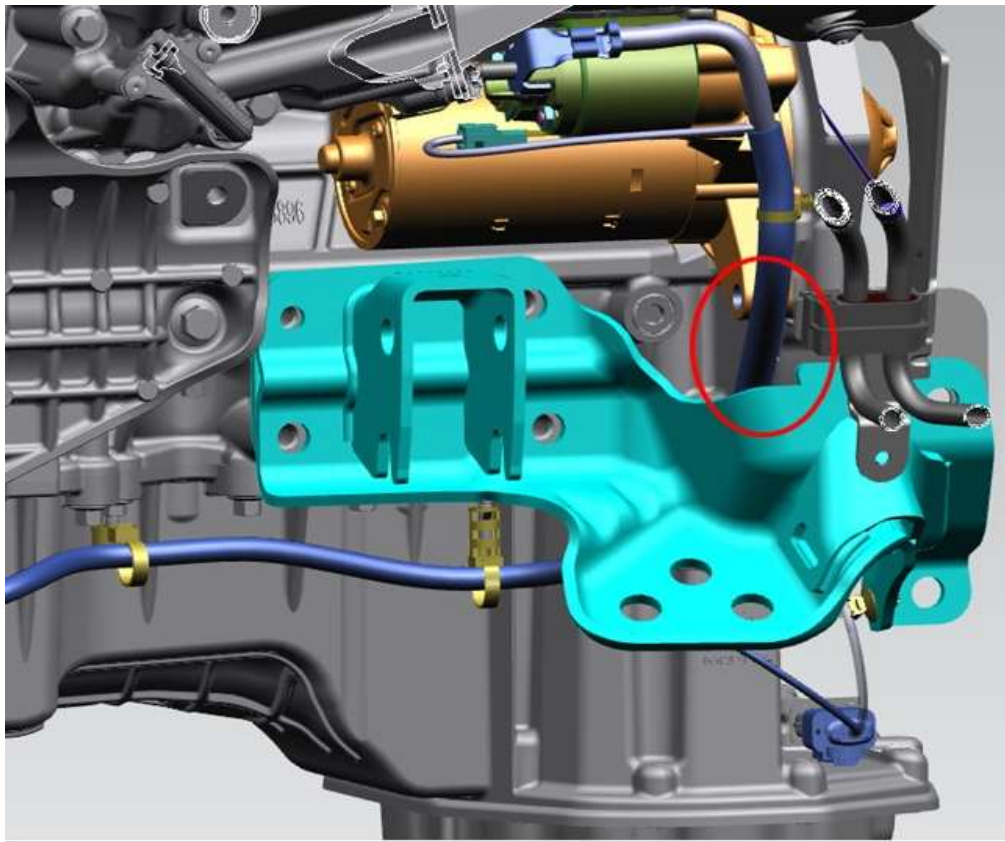

This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

**Contact STAR Center, or your Technical Assistance Center Via TechCONNECT or eCONTACT ticket if no solution is found**