

Reference	SSM75903
Models	New Range Rover / L460 New Range Rover Sport / L461
Title	L460/L461 Water leak in the roof rail attachment area.
Category	Body
Last modified	20-Dec-2022 00:00:00
Symptom	105000 Roof Options
Attachments	L460 L461 Roof Leak issue.pdf (L460 L461 Roof Leak issue.pdf)
Content	L460, L461

Issue:

Water leak in the roof rail attachment area, This causes a water leak into the cabin through the headlining or can track down through the posts to the carpet.

Cause:

Root cause defined as water ingress through the paint crack sealant which is split following bolt application as a finished vehicle.

Action:

Identify the general area of the vehicle that is leaking, is it near any of the roof rail bolt holes beneath the small roof finishers, if so, seal up the area as shown in the attachment.

- Apply PU sealant mentioned in TOPIX section 501-25C to two areas as shown
- Ensure sealant is in contact with the roof system PU adhesive bonding.
- Do not seal to the edge of the bodyside to allow in service drainage requirements

anBhdHRicnM7MjAyMj0xMj0yMj0yMz0yOS43NjBaOzEzNi4yMjYyNDguMTA2Ow==