

Reference	SSM75909
Models	E-PACE / X540 F-PACE / X761 F-TYPE / X152 XE / X760 XF / X260
Title	DTC P013E-00 Stored In Powertrain Control Module P4 And P6 Derivatives Only
Category	Driveability
Last modified	20-Dec-2022 00:00:00
Symptom	698298 Malfunction Indicator Lamp
Content	<p>Issue: When carrying out an engine diagnostic session using TOPIx Cloud the following Diagnostic Trouble Code (DTC) P013E-00 'O2 Sensor Delayed Response - Rich to Lean Bank 1 Sensor 2' may be present in the Powertrain Control Module (PCM).</p> <p>Cause: Sensitive trigger point for storage of DTC P013E-00.</p> <p>Action: When carrying out diagnosis of DTC P013E-00 and the diagnostic flow guides towards a fault with the oxygen sensor do not replace the sensor if the DTC is listed as '<u>Historic</u>' as it is unlikely the sensor is the root cause. If the DTC is listed as '<u>Confirmed</u>' and after the appropriate diagnostic path and continuity checks have been followed with no fault identified, then consideration may be given to a replacement oxygen sensor.</p> <p><small>anBhdHRicnM7MjAyMl0xMl0yMlVQxNzoxMj00M42OTNaOzEzNi4yMjYyNDguMTA2Ow==</small></p>