

992- Turbo and Turbo S PDK II Operation in Manual Mode

Vehicles Affected


Models	Model Year	Model Type	VIN Range	Vehicle-Specific Equipment
911	2020 - 2022	992430 992450 992630 992650	n/a	n/a

Revision History

Revision	Release Date	Changes
0	December 9, 2022	Original document

Condition

Customer complains an upshift request via the right shift paddle in manual ('M') mode operation from 1st to 2nd gear does not execute in the gearbox. This upshift request fails to execute even at higher engine speeds while operating in 'M.'

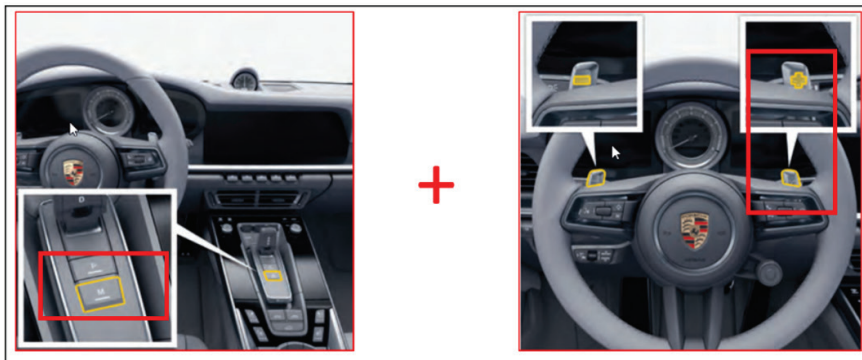

Upshift from 1st  2nd Gear is restricted in Manual Mode.

Technical Background

A software strategy in the aforementioned models prohibits the first to second gear upshift in 'M' operation.

Service Information

A software update to allow the upshift from first to second gear in 'M' for a subsection of the affected vehicles is available for model year 2022 cars in the latest PIWIS tester version. Please update the PDK control unit to software version 0580 in the tester according to standard workshop procedures. This bulletin will be updated accordingly when the software is available for older models.

Warranty

As always, please document the repair completely in PQIS.

For this repair, please code the "cause" as follows:

Cause location: 37340 Double-clutch transmission

Cause symptom: 1127 does not switch

Search Items

992, turbo, turbo s, upshift, PDK II, transmission, M, manual mode, right shift paddle

Important Notice: Technical Bulletins issued by Porsche Cars North America, Inc. are intended only for use by professional automotive technicians who have attended Porsche service training courses. They are written to inform those technicians of conditions that may occur on some Porsche vehicles, or to provide information that could assist in the proper servicing of a vehicle. Porsche special tools may be necessary in order to perform certain operations identified in these bulletins. Use of tools and procedures other than those Porsche recommends in these bulletins may be detrimental to the safe operation of your vehicle, and may endanger the people working on it. Properly trained Porsche technicians have the equipment, tools, safety instructions, and know-how to do the job properly and safely. Part numbers listed in these bulletins are for reference only. The work procedures updated electronically in the Porsche PIWIS diagnostic and testing device take precedence and, in the event of a discrepancy, the work procedures in the PIWIS Tester are the ones that must be followed.
