



STAR ONLINE PUBLICATION




Case Number: S2208000191

Release Date: December 2022

Symptom/Vehicle Issue: Passenger Power Adjustable Mirror Does Not Operate, Service Blind Spot Message Displayed on Cluster

Customer Complaint/Technician Observation: Owner complains the power adjustable mirrors do not adjust and/or cluster displays a message to service the blind spot system. Technician observed the adjustable mirror does not adjust and/or vehicle is setting Diagnostic Trouble Code (DTC) B285F-15 Blind Spot Warning Light Control Circuit.

Repair Procedure: Inspect the I6626A 10-way black component connector, review for damaged or pushed out terminals. Use the push-pull-push method to secure unseated connectors, no parts required.

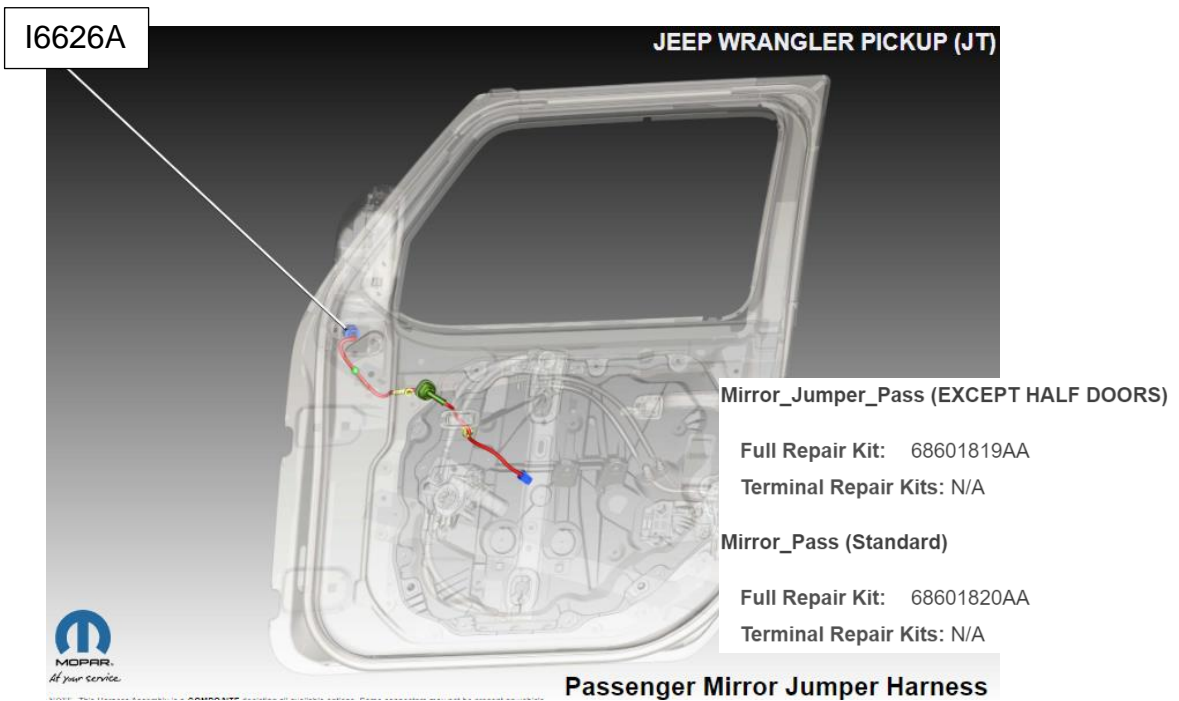

This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

Contact STAR Center, or your Technical Assistance Center Via TechCONNECT or eCONTACT ticket if no solution is found