

STAR ONLINE PUBLICATION















Case Number: S2208000194

Release Date: December 2022

Symptom/Vehicle Issue: Right or Left Reverse Back Up Lamp Inoperative, Cluster Warning Message for a Lamp Out

Message for a Lamp Out

Customer Complaint/Technician Observation: Owner complains of a lamp out message displayed on the cluster with a reverse lamp out. Technician observed the vehicle sets either Diagnostic Trouble Code (DTC) B1707-15 Left or B170B-11 Right, Reverse Lamp Control Circuit.

Repair Procedure: Inspect connector XY910A 48-way grey and black connector at the rear of the left front wheel well. Examine the connector for any bent and/or pushed out terminals. Inspect the harness routing at the left front body mount for signs of contact or chaffing. Repair or replace any bent or pushed out terminals and isolate and reposition the harness as needed Fig 1 and 2.

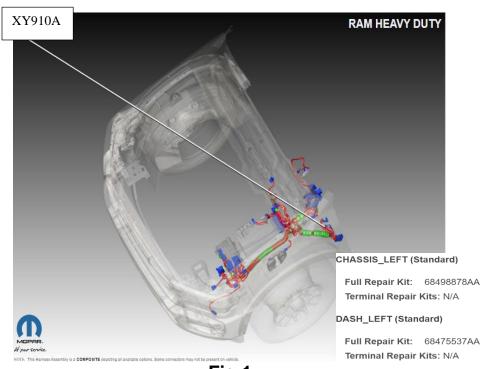


Fig 1

This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

Contact STAR Center, or your Technical Assistance Center Via TechCONNECT or eCONTACT ticket if no solution is found

Stellantis US LLC Version 4.5 06/08/2022



STAR ONLINE PUBLICATION















OK/NOK



Picture Description

Picture above shows GOOD part. (Enter description of



Picture Description

Picture above shows BAD/DEFECTIVE part. The issue



Fig 2

This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

Contact STAR Center, or your Technical Assistance Center Via TechCONNECT or eCONTACT ticket if no solution is found

Stellantis US LLC Version 4.5 06/08/2022