


Case Number: S2208000197

Release Date: December 2022

Symptom/Vehicle Issue: Cluster Message "Service Air Suspension"

Customer Complaint/Technician Observation: Owner complains of a cluster message to service the air suspension of the vehicle. Technician observed Diagnostic Trouble Codes (DTCs) C152A-15 Right Rear Ride Height Sensor Short to Battery or Open and/or C1526-15 Left Rear Ride Height Sensor Short to Battery or Open.

Repair Procedure: If DTCs C152A-15 & C1526-15 open circuit / short to battery were stored or active. Disconnect the height sensor and inspect the connector and terminals for loose or pushed out terminals. Inspect for any contaminates within the connector and clean and re-connect the sensor. Ensure the connector is fully seated and the connector retaining lock is secure. Use the scan tool to perform the height sensor operational check prior to any component replacement. The test will validate the system and component functionality, pg 1 and 2.

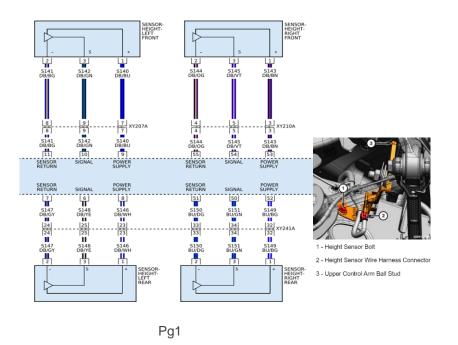

This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

Contact STAR Center, or your Technical Assistance Center Via TechCONNECT or eCONTACT ticket if no solution is found

Stellantis US LLC



Example: Air Suspension Control Module (ASCM) Height Sensor Check in the System Tests folder.

ASCM							
Air Suspension Control Module							
Flash	DTCs	Data	Misc Functions	System Tests	Actuators	Details	Configuration
NAME							
Air Spring Circuit Test							
ASCM Leak Down Test							
Atmosphere Valve Actuator Test							
Height Sensor Check							
					T047	6KS 🟦 Crea	ate JIRA [🗋 📮 🔊
Ф.	2022 WA MDS 1C4SJVFJ4NS		GRAND WAGON	IEER 6.4L V8 S	RT HEMI	۶	188 🖽 13.00 Volts 📃 🕻
Hei	ght Sensor	Check					
This routine will test the height sensors and linkages for proper function, as well as installation.							
							Cancel Continue

Pg 2

This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

Contact STAR Center, or your Technical Assistance Center Via TechCONNECT or eCONTACT ticket if no solution is found

Stellantis US LLC