



NUMBER: 23-052-22

GROUP: 23 - Body

DATE: December 1, 2022

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of FCA US LLC.

This Technical Service Bulletin (TSB) has also been released as a Rapid Service Update (RSU) 22-230, date of issue December 01, 2022. All applicable Sold and Un-Sold RSU VINs have been loaded. To verify this RSU service action is applicable to the vehicle, use VIP or perform a VIN search in DealerCONNECT/Service Library. All repairs are reimbursable within the provisions of warranty. This RSU will expire 18 months after the date of issue.

SUBJECT:

Water Leak in Rear Cargo Area

OVERVIEW:

This bulletin involves covering up two bolt holes with foil tape.

MODELS:

2023 (WL) Grand Cherokee

NOTE: This bulletin applies to vehicles within the following markets/countries: North America.

NOTE: This bulletin applies to vehicles built on or after August 04, 2022 (MDH 0804XX) and built on or before September 23, 2022 (MDH 0923XX) and Hidden Exhaust Tip-Single (Sales Code NEH) without 7 and 4 Pin Wiring Harness (Sales Code XF2).

SYMPTOM/CONDITION:

Customers may comment on the following:

- Water leaking in the cargo area at the back of the vehicle.

PARTS REQUIRED:

Qty.	Part No.	Description
(1)	05160291AA	Foil Tape

DIAGNOSIS:

If a customer's VIN is listed in VIP or your RSU VIN list, perform the repair. **This RSU only applies to vehicles on the RSU VIN list.**

REPAIR PROCEDURE:

1. Raise the vehicle on the hoist. Refer to the detailed procedures available in DealerCONNECT > Service Library > under: 04 - Vehicle Quick Reference / Hoisting / Standard Procedure.

NOTE: If the vehicle was equipped with a dual exhaust these two bolt holes would be used for the bolts of the rear exhaust hanger.

2. Locate two open bolt holes located at the left rear of the vehicles (Fig. 1) and (Fig. 2) .

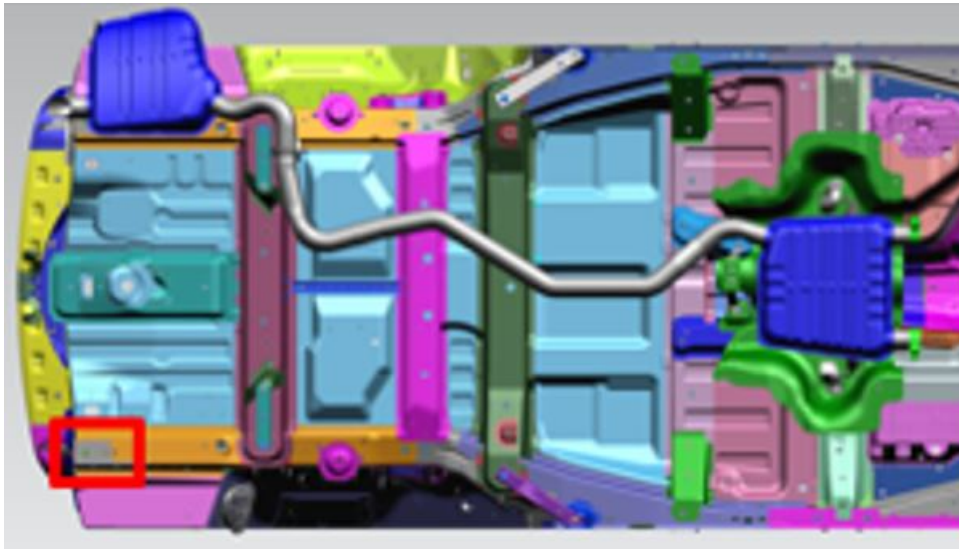


Fig. 1
Bolt Hole Location

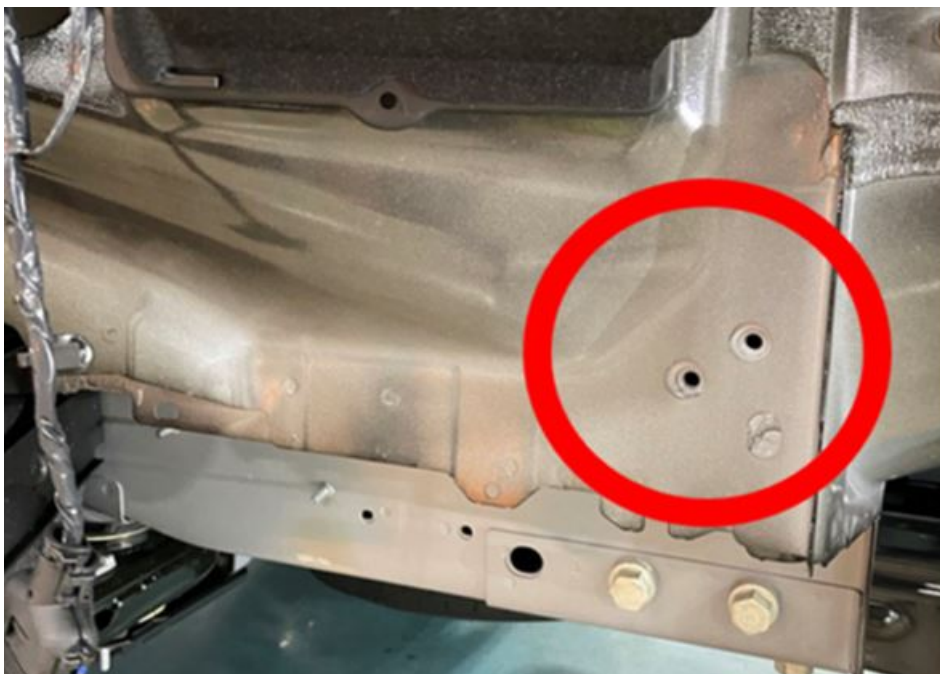


Fig. 2
Open Bolt Holes

3. Clean the area with alcohol.
4. Apply foil tape over the open bolt holes.
5. Lower the vehicle. This bulletin has been completed.

POLICY:

Reimbursable within the provisions of the warranty.

TIME ALLOWANCE:

Labor Operation No:	Description	Skill Category	Amount
23-00-41-95	Tape, Foil - Install (0 - Introduction)	6 - Electrical and Body Systems	0.3 Hrs.

FAILURE CODE:

ZZ	Service Action
----	----------------