



## STAR ONLINE PUBLICATION



**Case Number:** S2208000139


**Release Date:** July 2022

**Symptom/Vehicle Issue:** Check Engine Lamp (CEL) Multiple Diagnostic Trouble Codes (DTC)

**Customer Complaint/Technician Observation:** Owner complains the CEL lamp turns on. Technician observed the CEL lamp on with any of the combined multiple DTC's setting P0131, P0365, P0652, P2127, P0335, P0335, P0340, P04CE, P1628, P0032, P0031, P1128, P0344, P000C.

**Discussion:** Inspect the harness routing at the below highlighted area near the back right side of engine/bulkhead. Review the harness routing at the coolant hose clamps inspecting for harness damage chafing/cuts.

Repair any harness damage following the splice/repair guidelines within Service Library, **28 - DTC-Based Diagnostics / Circuit Testing Procedures / Standard Procedure WIRE SPLICING**. Rotate the hose clamps 180 degrees if any contact to ensure the greatest clearance for the harness. Isolate, secure and reposition the harness at any contact areas to complete the repair.

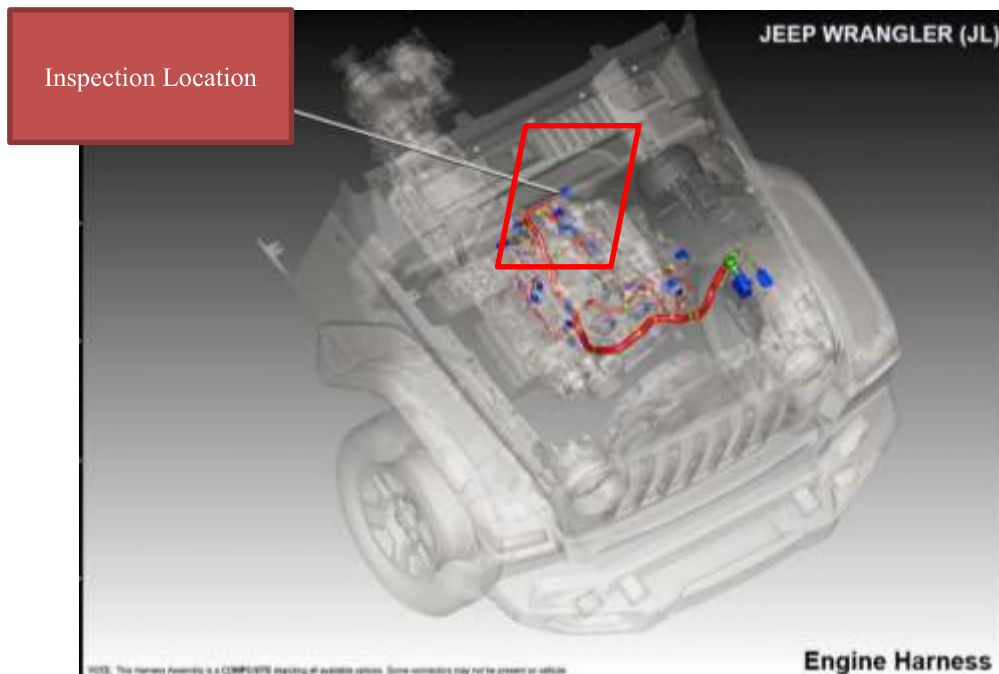

This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

**Contact STAR Center, or your Technical Assistance Center Via TechCONNECT or eCONTACT ticket if no solution is found**