

Subject

**22MY Tundra/HV - MIL ON w/DTC(s) P017400, P043000 - Debris In Bank 2 Fuel Delivery Pipe**

Market

**USA**

Service Category

**Vehicle Interior**

Section

**Meter/Gauge/Display**

Applicability

**22MY Tundra/HV**

**APPLICABLE VEHICLES**

2022	Tundra	2022	Tundra HV
------	--------	------	-----------

**CONDITION**

Some 22MY Tundra/HV vehicles may experience a MIL ON w/DTC(s) P017400, P043000. Other symptoms of this issue include poor acceleration. A lean condition may cause damage to the internal catalyst in the catalytic converter. See pictures below for condition:



Damage to bank 2 catalytic converter.

Subject

**22MY Tundra/HV - MIL ON w/DTC(s) P017400, P043000  
- Debris In Bank 2 Fuel Delivery Pipe**



Market

USA

Applicability

**RECOMMENDATIONS**

If this condition is identified, it is recommended to disassemble the No.3 fuel pipe sub assembly to inspect for obstruction and debris in the bank 2 high pressure fuel rail. Debris in the fuel rail can cause fuel blockage leading to a lean condition and poor acceleration. See below for details:

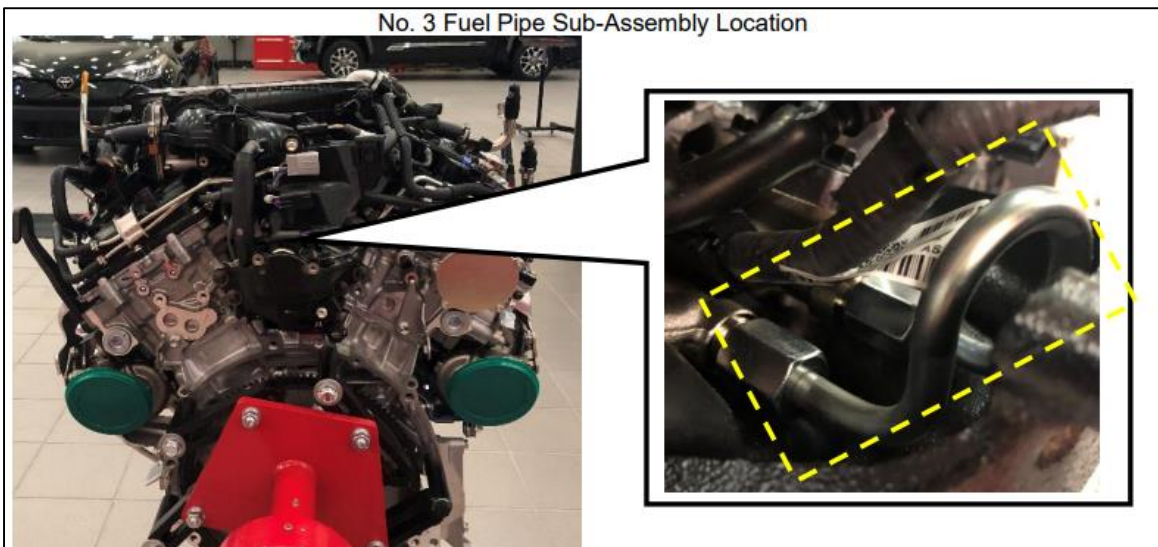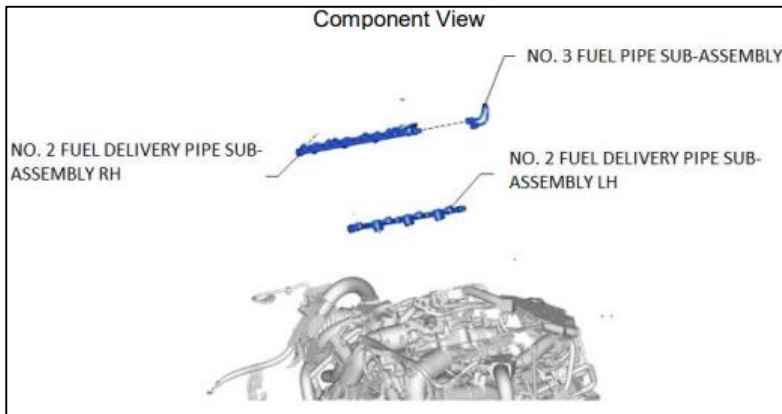

If this condition is identified, it is important to check for debris in the LH No.2 Fuel Delivery Pipe and No.3 Fuel Pipe Sub Assy connection port to help eliminate any repeat repairs for customers. Please create a TAS case and contact TAS for instruction prior to diagnosing or repairing of the vehicle. Please save all parts and/or details and submit a field report.

**LINK REFERENCES**

Subject

**22MY Tundra/HV - MIL ON w/DTC(s) P017400, P043000  
- Debris In Bank 2 Fuel Delivery Pipe**

Market

USA

Applicability

This Tech Tip does not contain any link references

Click here to enter text.