



NUMBER: 18-155-22

GROUP: 18 - Vehicle Performance

DATE: November 29, 2022

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of FCA US LLC.

SUBJECT:

Flash: Powertrain Control Module (PCM) Updates

OVERVIEW:

This bulletin involves reprogramming the PCM with the latest available software.

MODELS:

2023 (JL) Jeep Wrangler

NOTE: This bulletin applies to vehicles within the following markets/countries: North America.

NOTE: This bulletin applies to vehicles built on or before October 26, 2022 (MDH 1026XX) equipped with a 3.0L V6 Turbo Diesel Engine W/ESS (Sales Code EXJ).

SYMPTOM/CONDITION:

Customers may experience a Malfunction Indicator Lamp (MIL) illumination. Upon further investigation, a technician may find one or more of the following Diagnostic Trouble Codes (DTCs) have been set:

- P016F - Closed Loop Fuel Pressure Control At Limit - Pressure Too Low.
- P025C - Fuel Pump Module Control Circuit Low.
- P0300-00 - Multiple Cylinder Misfire.
- P0301-00 - Cylinder 1 Misfire.
- P0302-00 - Cylinder 2 Misfire.
- P0303-00 - Cylinder 3 Misfire.
- P0304-00 - Cylinder 4 Misfire.
- P0305-00 - Cylinder 5 Misfire.
- P0403-00 - EGR Control Circuit Open (Disabled Fault).
- P208B - Reductant Pump 1 Control Performance.

Other Software enhancements:

- Low speed engine idle improvements.
- Improved engine restart performance and torque response during low fuel level and/or hot ambient conditions.

DIAGNOSIS:

Using a Scan Tool (wiTECH) with the appropriate Diagnostic Procedures available in DealerCONNECT/Service Library, verify all related systems are functioning as designed. If DTCs or symptom conditions, other than the ones listed above are present, record the issues on the repair order and repair as necessary before proceeding further with this bulletin.

If the customer describes the symptom/condition listed above or if the technician finds the DTC, perform the Repair Procedure.

REPAIR PROCEDURE:

NOTE: Install a battery charger to ensure battery voltage does not drop below 13.2 volts. Do not allow the charging voltage to climb above 13.5 volts during the flash process.

NOTE: If this flash process is interrupted/aborted, the flash should be restarted.

1. Reprogram the PCM with the latest software. Detailed instructions for flashing control modules using the wiTECH Diagnostic Application are available by selecting the application's "HELP" tab.
2. Clear any DTCs that may have been set in any modules due to reprogramming. The wiTECH application will automatically present all DTCs after the flash and allow them to be cleared.

POLICY:

Reimbursable within the provisions of the warranty.

TIME ALLOWANCE:

Labor Operation No:	Description	Skill Category	Amount
18-19-04-TE	Module, Powertrain Control (PCM) - Inspect and Reprogram (0 - Introduction)	10 - Diesel	0.3 Hrs.

NOTE: The expected completion time for the flash download portion of this procedure is approximately 9 minutes. Actual flash download times may be affected by vehicle connection and network capabilities.

FAILURE CODE:

The dealer must use failure code CC with this Technical Service Bulletin.

- If the customer's concern matches the SYMPTOM/CONDITION identified in the Technical Service Bulletin, failure code CC is to be used.
- When utilizing this failure code, the 3C's (customer's concern, cause and correction) must be provided for processing Technical Service Bulletin flash/reprogramming conditions.

CC	Customer Concern
----	------------------