# **Technical Journal**

#### TITLE:

# Long Range PHEV Message in DIM "System Check Please Wait" (ECM U DTCs)

REF NO:	ISSUING DEPARTMENT:	CAR MARKET:		
36298.3.0	Technical Service	United States		
	PARTNER:	ISSUE DATE:	STATUS DATE:	
3 US 751	0 Volvo Car USA, LLC	2022-11-23	2022-11-30	
FUNC GROUP:	FUNC DESC:			
2800	Ignition and control system	Page 1 of 2		

"Right first time in Time"

Rows beginning with \* are modified

Note! If using a printed copy of this Technical Journal, first check for the latest online version.

### **DESCRIPTION:**

If a customer attempts to start the vehicle while the charging cable is still connected to the vehicle, a "Propulsion Service Required" message, or a "System Check, Please Wait" message may occur in the Driver Information Module (DIM) after three start attempts. The following Diagnostic Trouble Codes (DTC): ECM U011131, ECM U011068, and ECM U012031 will be set as either confirmed or not confirmed. Please follow the instructions under "Service."

## **CSC** Customer Symptom Codes

Code	Description
DL	Warning lights and chimes/Malfunction Indicator Light ("Check engine" light) indication/no indication

## **DTC** Diagnostic Trouble Codes

ECU	DTC	Fault Type
ECM	U011131	Intermittent
ECM	U011068	Intermittent
ECM	U012031	Intermittent

# Technical Journal 36298.3.0

# **Vehicle Type**

Туре	Eng	Eng Desc	Sales	Body	Gear	Steer	Model Year	Plant	Chassis range	Struc Week Range
224	Н6	BH6PHEV					2022-2025		-	202147-202552
225	Н6	BH6PHEV					2022-2025		-	202147-202552
235	Н6	BH6PHEV					2022-2025		-	202147-202552
238	Н6	BH6PHEV					2022-2025		-	202147-202552
246	Н6	BH6PHEV					2022-2025		-	202147-202552
256	Н6	BH6PHEV					2022-2025		-	202147-202552

#### **SERVICE:**

If all three DTCs: ECM U011131, ECM U011068, and ECM U012031 are set, erase the DTCs and **install a Total Upgrade software**.

Advise the customer to ensure that the charging cable is disconnected before attempting to start the car in the future.

## Warranty claim info:

To get a warranty claim accepted for a job described in this TJ, please use the following data:

VST OP number: 36004-2

Note that the TJ number must be stated in the repair order text.

## **VST** Operation Number

VST Operation Number	Description
36004-2	Software control module downloading

### **VEHICLE REPORT:**

Yes, please submit a Vehicle Report if the service solution described in this TJ has no effect. Use concern area "Vehicle Report" and sub concern area "Support needed", use function group 2800.

Page 2 of 2 2022-11-30

<sup>\*</sup>Software improvements were released on week 47, 2022.