

# Service Bulletin

23-001

January 6, 2023 Version 1

# Product Update: 2016–20 MDX PGM-FI Idle Stop Software Update

## **AFFECTED VEHICLES**

Year	Model	Trim	VIN Range
2016–2020	MDX	All (except Hybrid)	Check the iN VIN status for eligibility.

#### **BACKGROUND**

Under certain circumstances, after coming to a stop and the idle stop feature engages, the vehicle may not automatically restart. Typically, the customer can immediately restart the vehicle by selecting Park and pushing the ENGINE START/STOP button.

#### **CLIENT NOTIFICATION**

Owners of affected vehicles will be sent a notification of this product update.

Do an iN VIN status inquiry to verify eligibility.

Some vehicles affected by this campaign may be in your new or used vehicle inventory. Repair these vehicles before they are sold.

## **CORRECTIVE ACTION**

Update the PGM-FI Software.

NOTE: The software update will decrease the Idle Stop operating range. As a result, the client may notice reduced idle stop engagement when their vehicle's battery is approaching the end of its useful life.

## **WARRANTY CLAIM INFORMATION**

Operation Number	Description	Flat Rate Time	Defect Code	Symptom Code	Template ID	Failed Part Number
1255G6	Update the PGM-FI Software (Idle Stop)	0.2hr	6AX00	UCR00	B23001A	37805-5J6-A75

**CLIENT INFORMATION:** The information in this bulletin is intended for use only by skilled technicians who have the proper tools, equipment, and training to correctly and safely maintain your vehicle. These procedures should not be attempted by "do-it-yourselfers," and you should not assume this bulletin applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Acura automobile dealer.

## **SOFTWARE INFORMATION**

NOTE: Unnecessary or incorrect repairs resulting from a failure to update the diagnostic and reprogramming software are not covered under warranty.

Before beginning the repair, make sure all diagnostic and reprogramming software are updated as listed.

i-HDS Software Version	1.008.004 or later			
HDS Software Version	3.105.009 or later			
J2534 Rewrite Software Information				
PC Application Version	1.00.0034_2461			
Database Update	05-OCT-2022 or later			
NoticeDB Version	05-OCT-2022 or later			

Update only the systems and software listed in this service bulletin.

Do not use the MongoosePRO VCI for this service bulletin as it is not an American Honda-approved device.

For more information about updating vehicle systems, refer to service bulletin 22-100, *Updating Control Units/Modules*.

Year/Model	Vehicle System	Program ID (or later)	
2016 ADV (2WD)	PGM-FI	37805-5J6-5460	
2016 ADV (SH-AWD)	PGM-FI	37805-5J6-5470	
2017 ADV (2WD)	PGM-FI	37805-5J6-7030	
2017 ADV (SH-AWD)	PGM-FI	37805-5J6-7130	
2018 ADV (2WD)	PGM-FI	37805-5BN-3360	
2018 ADV (SH-AWD)	PGM-FI	37805-5BN-3380	
2019 BASE (2WD), TECH (2WD), ADV (2WD)	PGM-FI	37805-5BN-A750	
2019 BASE (SH-AWD), TECH (SH-AWD), ADV (SH-AWD), A-Spec (SH-AWD)	PGM-FI	37805-5BN-A950	
2020 BASE (2WD), TECH (2WD), ADV (2WD)	PGM-FI	37805-5BN-A340	
2020 BASE (SH-AWD), TECH (SH-AWD), ADV (SH-AWD), ADV (SH-AWD PMC ED), A-Spec (SH-AWD)	PGM-FI	37805-5BN-A540	

#### SOFTWARE UPDATE PROCEDURE

# NOTICE

- Make sure the 12-volt battery is fully charged before starting an update.
- Connect a fully charged jumper battery to the vehicle, and leave it connected during the entire procedure to maintain a steady voltage.
- Do not use the GR8 because the vehicle requires a steady electrical current.
- Control module failure caused by improperly completing a software update (early key cycle, low battery voltage, disconnected DLC cable, etc.) is not covered by warranty.
- If an error occurs during the update or the i-HDS freezes, do not disconnect the battery or turn the ignition to OFF. Reboot the i-HDS, and start over.
- To prevent control unit damage, do not operate anything electrical (headlights, audio system, brakes, A/C, power windows, door locks, etc.) during the update.
- Warranty reimbursement for technician labor is not allowed for **routine** checking/installation of any available software update.


Update the parking system software using the J2534 rewrite software with the DST-i. Refer to service bulletin 01-023,Updating Control Units/Modules

NOTE: This update will not require entering a service bulletin number.


1. From the desktop, select **i-HDS**.



2. From the HOME menu, select the **J2534 Rewrite** under Related Applications"

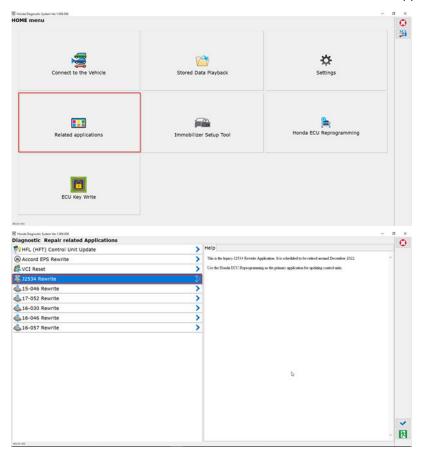

3. When prompted select **Start**, do not enter a service bulletin number.

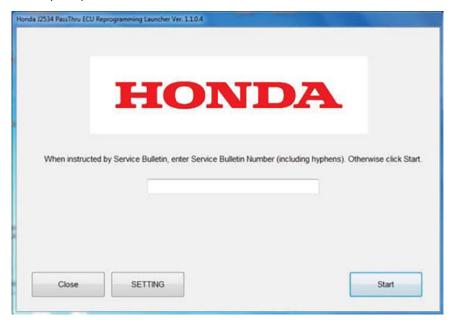


NOTE: Under certain conditions the **HOME menu** screen may come up. If it does, just minimize it to show the screen under it.


4. Connect the i-HDS to the vehicle and select **Start** to begin reprogramming.



5. Follow the screen prompts, then select **Next.** 

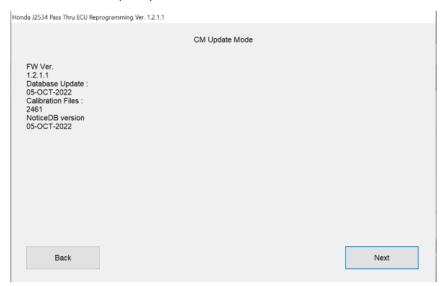


6. Enter the VIN and repair order number. Then, select Next.

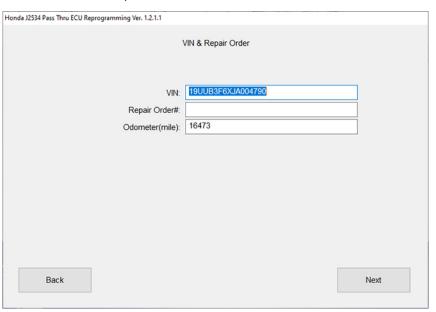


7. Select the **PGM-FI**, and then **Select**.


NOTE: Wait until vehicle communication has completed.

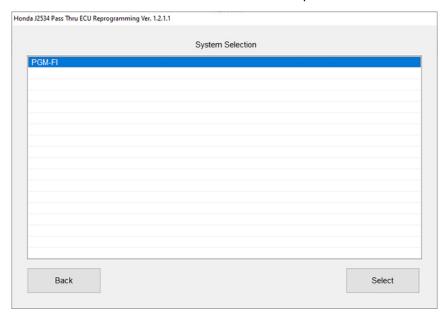

8. Confirm the update information, then select **ENTER** to proceed.

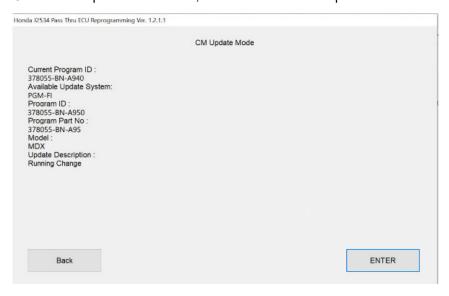


9. Select **ENTER** to begin reprogramming, and follow the screen prompts.

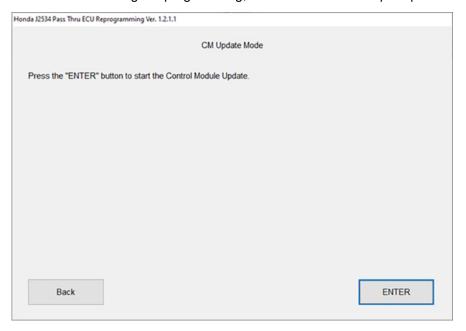




onda J2534 Pass Thru ECU Reprogramming Ver. 1.2.1.1
CM Update Mode
PGM-FI Completed. Turn the ignition switch OFF.
onda J2S34 Pass Thru ECU Reprogramming Ver. 1.2.1.1
wine reserve as the east reprogramming terminal
CM Update Mode

10. Once the module is updated, the following screen appears, then select **EXIT.** 

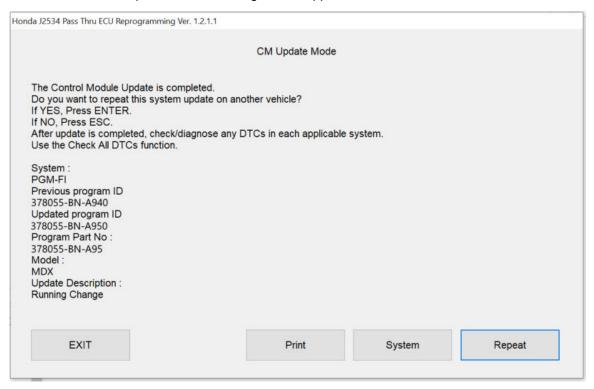

- 11. Do an ALL DTC Check then clear any codes set during the update.
- 12. California residents only: Fill out a Vehicle Emissions Recall Proof of Correction certificate, and use UCR as the recall number. Have the service consultant give the certificate to your client and advise them to keep it as proof that the recall was completed. Your client will need to submit this certificate to the DMV only if requested. If you need more certificates, use reorder number Y0657.

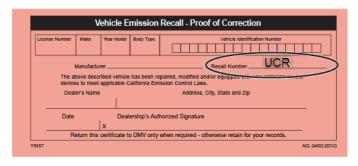

**END**