

# Technical Service Bulletin



## 01 MIL on; cylinder misfires (DTCs P0300, P0301, P0302, P0303, P0304, P0305, P0306)

01 23 35 2069038/2 January 6, 2023. Supersedes Technical Service Bulletin Group 01 number 22-31 dated December 22, 2022, for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A6, and A7	2019	All	3.0 L Engine

## Condition

REVISION HISTORY		
Revision	Date	Purpose
2	-	Revised header (Updated Filter)
1	12/22/2022	Initial publication

### Customer states:

MIL may be illuminated.

### Workshop findings:

The following DTCs may be stored:

- **DTC P0300:** Random/Multiple Cylinder Misfire Detected
- **DTC P0301:** Cyl.1 Misfire Detected
- **DTC P0302:** Cyl.2 Misfire Detected
- **DTC P0303:** Cyl.3 Misfire Detected
- **DTC P0304:** Cyl.4 Misfire Detected
- **DTC P0305:** Cyl.5 Misfire Detected
- **DTC P0306:** Cyl.6 Misfire Detected

## Technical Background

The software needs to be updated. The optimized software will correct the misfire and prevent the MIL from illuminating.

## Production Solution

New software in the control module, -J623- (address word 0001) addressed the condition.

## Service

### SVM Update Instructions

# Technical Service Bulletin



1. Follow all instructions in TSB 2011732: 00 Software Version Management (SVM), operating instructions.
2. Update the ECM, J623 (address word 0001) using the SVM action code as listed in the table below, if necessary:

Model	Old Target Data Container Number	Old Target Data Container Version	New Target Data Container Number (or higher)	New Target Data Container Version (or higher)	SVM Code Input
A6	4K0907559A	0007	4K0907559A	0008	01A255
A7	4K0907559A	0007	4K0907559A	0008	01A255

## Warranty

<b>Claim Type:</b>	<ul style="list-style-type: none"> <li>• 110 up to 48 Months/50,000 Miles.</li> <li>• G10 for CPO Covered Vehicles – Verify Owner.</li> <li>• 1E1 up to 8 years/80,000 Miles.</li> <li>• If the vehicle is outside any warranty, this Technical Service Bulletin is informational only.</li> </ul>		
<b>Service Number:</b>	2470		
<b>Damage Code:</b>	0039		
<b>Labor Operations:</b>	Software Update (Includes checking for DTCs)	0151 0000	Time stated on the diagnostic protocol (Max 50 TU)
<b>Diagnostic Time:</b>	GFF	0150 0000	Max 15 TU
	Road test prior to the service procedure	No allowance	0 TU
	Road test after the service procedure	0121 0004	10 TU
<b>Claim Comment:</b>	As per TSB 2069038/2		

All warranty claims submitted for payment must be in accordance with the Audi Warranty Policies and Procedures Manual. Claims are subject to review or audit by Audi Warranty.

## Required Parts and Tools

Tool Number	Tool Description
VAS 6160/VAS 6150	VAS tester with the current version of ODIS (Windows 10).



## Additional Information

The following Technical Service Bulletin(s) will be necessary to complete this procedure:

- TSB 2011732: 00 Software Version Management (SVM), operating instructions.

All part and service references provided in this TSB (**2069038**) are subject to change and/or removal.

©2023 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.