

Technical Service Bulletin



94 "Electrical system fault" is displayed in the instrument cluster, DTC: P18F100, P0A1B00, U140500
94 23 61 2068617/2 January 17, 2023. Supersedes Technical Service Bulletin Group 94 number 22-60 dated November 18, 2022, for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
Q4 e-tron, and Q4 Sportback e-tron	2022	All	Not Applicable

Condition

REVISION HISTORY		
Revision	Date	Purpose
2	-	Revised <i>Required Parts and Tools</i> (Added wiring seal and plug)
1	11/18/2022	Initial publication

Customer states:

The message **"Electrical system: fault. Please contact workshop"** intermittently appears in the instrument cluster.

Workshop findings:

One or more of the following DTCs are stored in the Electric Drive 2, J944 (address word 00CE):

- **DTC U140500:** *Terminal 15 implausible signal*

DTC P0A1B00: *Drive Motor A control module*

DTC P18F100: *Function limitation due to deviating wheel speeds*

Technical Background

Pins may have become damaged during the end-of-line check during production.

Production Solution

Assembly of wiring harnesses optimized during production.

Service

Inspect connector T10 at power electronics 2 for electric drive JX4 for spread or damaged contacts:

If any damage is found to the pins or connector, replace the 10-pin connector and associated wires/pins.



Note: **DO NOT** de-pin the connector. Cut the connector off the harness leaving approximately 5cm of the harness attached to the connector. Retain the connector and harness section for analysis.

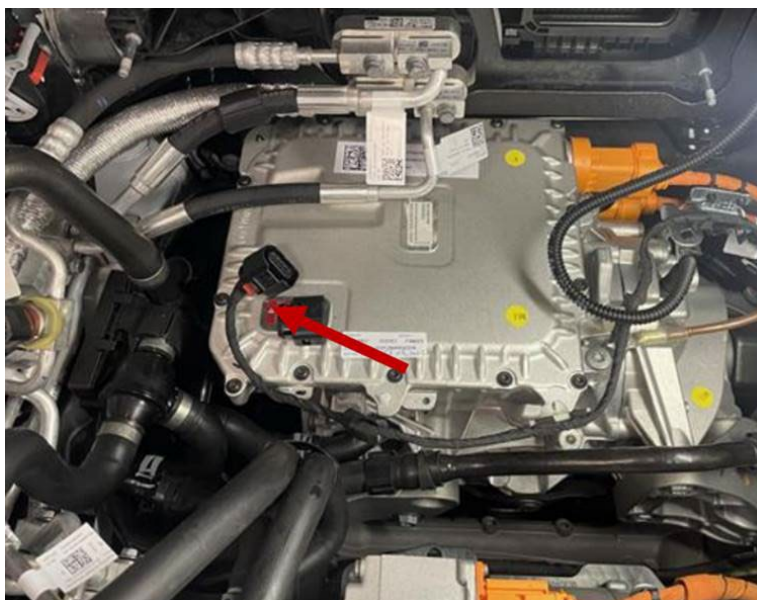


Figure 1: 10 Pin connector.

Replace the connector and repair the harness using **VAS 1978B**.

In the warranty claim ensure part number **4H0 973 715 A** is claimed as the causal part.

Warranty

Claim Type:	110 up to 48 Months/50,000 Miles. G10 for CPO Covered Vehicles – Verify Owner. If the vehicle is outside of any warranty, this Technical Service Bulletin is informational only.		
Service Number:	9709		
Damage Code:	0023		
Labor Operations:	Remove and install outer heater/fresh air blower	8515 1950	See SRT with associated operations
	Check wiring harness	9709 0199	10 TU
	Repair wire harness	9709 4156	See SRT with associated operations
Diagnostic Time:	GFF	0150 0000	Time stated on the diagnostic protocol (Max 100 TU)

Technical Service Bulletin



	Road test prior to the service procedure	No allowance	0 TU
	Road test after the service procedure	0121 0004	10 TU
Claim Comment:	As per TSB 2068617/2		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Required Parts and Tools

Always check with your Parts Department and/or ETKA for the latest information and parts bulletins.		
Part Number	Part Description	Quantity
See ETKA	Fasteners, Bolts, Nuts, and Screws as needed per the Repair Manual	See ETKA/ELSA
4H0 973 715 A	Flat contact housing	1
000 979 025 EA	Individual wire	3
000 979 150 EA	Individual wire	1
357 972 740 E	Wiring seal, 0.35 – 0.5 mm ²	5
3C0 972 741	Wiring seal, 1.0 mm ²	1
3C0 972 841	Plug	4
000 979 940	Crimp connector	5
000 979 941	Crimp connector	1
N 105 920 02	Fabric adhesive tape	.1

Tool Number	Tool Description
VAS 1978 B	Wire harness repair set
VAS 6160/VAS 6150	VAS tester with the current version of ODIS (Windows 10)

Additional Information

All parts and service references provided in this TSB (**2068617**) are subject to change and/or removal. ©2023 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may



these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.