Audi On-car analysis list from January, 27 2023 Please contact Audi Helpline before attempting repair All topics have associated worksheets to be filled out and attached to the TAC ticket. Worksheets can I ServiceNet>>Technician References>>Vin-4-Pin>>Worksheets

| | Models | MY | Engine | Trans | Торіс | Topic details |
|----|-----------------------------|-----------|--------|-------|---|--|
| РТ | Q3 | 2020-2021 | All | All | Coolant warning Lamp | Customer states they receive a low coolant waning in the cluster. Coolant level appears to be full in the reservoir • Case does not relate to TSB 2061918 • Photo showing reservoir level • Complete reservoir, connector and 4 inch harness section |
| | Q7/Q8 | 2021-2022 | All | All | Active Air Shutter | Check engine lamp is illuminated and DTC P05A000: Active Grille Air Shutter "A" Stuck is stored in the ECM. • P05A000: Active Grille Air Shutter "A" Stuck • Photos of the shutter motor |
| EL | Q3 | 2022 | Any | Any | MMI Display Ghost Touches | MMI display exhibits unintended clicks/screen changes due to "Ghost Touches" • Please ask the customer if the vehicle can be held for a couple days for further analysis by the part supplier. • If the customer is not willing, this Vin4Pin does not apply |
| | A5 | 2020-2022 | Any | Any | Rear PDC mount comes loose from bumper | Customer states one of the rear PDC sensors is pushed in or missing. It is discovered that the mount has come loose from the rear bumper. • Photo of painted side of rear bumper (shows no damage to cover) • Photo of rear of cover showing loose mount and bumper surface • Replace rear bumper • Return mount and bumper • Case is only eligible if mount and bumper are both able to be returned |
| | Q3 | 2022 | 2.0 | Any | Boost pressure sensor | Check engine lamp is on, DTC (s) P010600, P023600, P023700, P023800 Documentation needed: • Wiggle test harness • Check pin fitment and pin drag • Check circuit resistance (if needed) • Photos of findings • Q3 Boost pressure sensor worksheet |
| | Q3 | 2022 | Any | Any | Rear PDC sensor connector loose | Parking aid warning is displayed shortly after PDI. DTC B10F914: Right front center parking aid sensor Open circuit/short circuit to Ground (GND) may be set • DTC B107B13: Rear parking aid sensor Open circuit • Untouched vehicle (with exception to removing the bumper) • Photo of sensor connector as it was found Photo of bumper harness label |
| | A6 | 2022 | Any | Any | PDC sensor connector loose | Parking aid warning is displayed shortly after PDI. Either a front or rear PDC sensor is found not connected. • Untouched vehicles needed (with exception to removing the bumper) • Photos of sensor connector as it was found and bumper harness label |
| BD | e-tron Quattro e-tron SB | 2021-2022 | Any | Any | Noise from Front Door Trim Panel | Noise from front door trim panel while driving • Video of noise before repair is performed • Photos of repair |
| | A5 | 2021-2022 | Any | Any | Noise from Front Door speaker Grill | Noise from front door loudspeaker grille with music playback or while driving • Video of noise before repair is performed • Photos of repair • Photo of the sound settings in the MMI and the music genre/song |