

Warning Message "Steering" - No Power Steering Following Engine Start

Topic number	LI46.35-P-075512
Version	1
Function group	46.35 - Electrical steering
Date	11/7/22
Validity	Model series 167
Reason for change	

Complaint

No power steering available following engine start, warning message and indicator lamp "Steering" active in instrument cluster.

Fault code P063500: "The electric power steering has a malfunction. _" in control unit N68 "Electric power steering"

The fault code details show for "Root_Cause_ErrorID": 60015 - ECU reset occurred - No assist start-up was executed

Cause

Software error when starting the electric power steering control unit (N68).

Remedy

Perform software update of electric power steering, control unit N68.

Please also observe the guided check in XENTRY Diagnosis!

Symptoms				
Chassis/suspension > Steering system > Function > Support				
Chassis/suspension > Steering system > Function > Stiff/sluggish				
Chassis/suspension > Steering system > Function > Support starts too late				
Chassis/suspension > Steering system > Display message > Pow. steer. faulty Serviced Required				
Control unit/fault code				
Control unit		Fault text		
N68 - Electrical power steering (ES) (EPS167)		P063500 - The electric power steering has a malfunction. -		
Operation numbers/damage codes				
Op. no.	Operation text	Time	Damage code	Note

XENTRY TIPS

			4649490	Electric rack-and-pinion steering control unit, software release
--	--	--	---------	------------------------------------------------------------------