

Sliding Sunroof Panel of Panoramic Sliding Roof Reversed (Temporarily, Once, or Multiple Times) During Closing Process

Topic number	LI77.21-P-075807
Version	1
Function group	77.21 - Panoramic roof
Date	1/20/23
Validity	Model series 254 with SA code 413 (Panoramic roof)
Reason for change	

Complaint

Sliding sunroof panel of panoramic sliding sunroof reversed (temporarily, once, or multiple times) during closing process, without entrapment event.

Cause

Cause remains open.

For analysis, the information from the control unit log of the panoramic roof control unit (TSSR254) is required via a TIPS case.

Remedy

Further analyses

Requirement:

- The teach-in run for the automatic reversing function of the panoramic roof via XENTRY has still NOT been carried out

Please perform the following steps:

1. Create a TIPS case
2. Create control unit log of panoramic roof control unit (TSSR223, A98, PSD) (prerequisite: add-on 25071) and attach to TIPS case

Remedy

Standardize panoramic roof with diagnostic system and carry out teach-in run for automatic reversing function.

WIS-References

Document number	Title	Note
-----------------	-------	------

XENTRY TIPS

AD00.00-P-2000-06FR	Connect/disconnect diagnostic device	-
---------------------	--------------------------------------	---

Symptoms
Body > Roof system > Tilting/sliding sunroof system > Does not close

Operation numbers/damage codes				
Op. no.	Operation text	Time	Damage code	Note
541011	Perform control unit log incl. quick test	003 AW	8201DGR	
776901	Standardize panoramic sliding sunroof and teach in automatic reversing function	ZM	8201DGR	