



Service Bulletin


Bulletin No.: 22-NA-017

Date: January, 2023


TECHNICAL

Subject: Liftgate Paint Peeling or Chipping at Applique

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Suburban	2021	2022			All	All
	Tahoe						

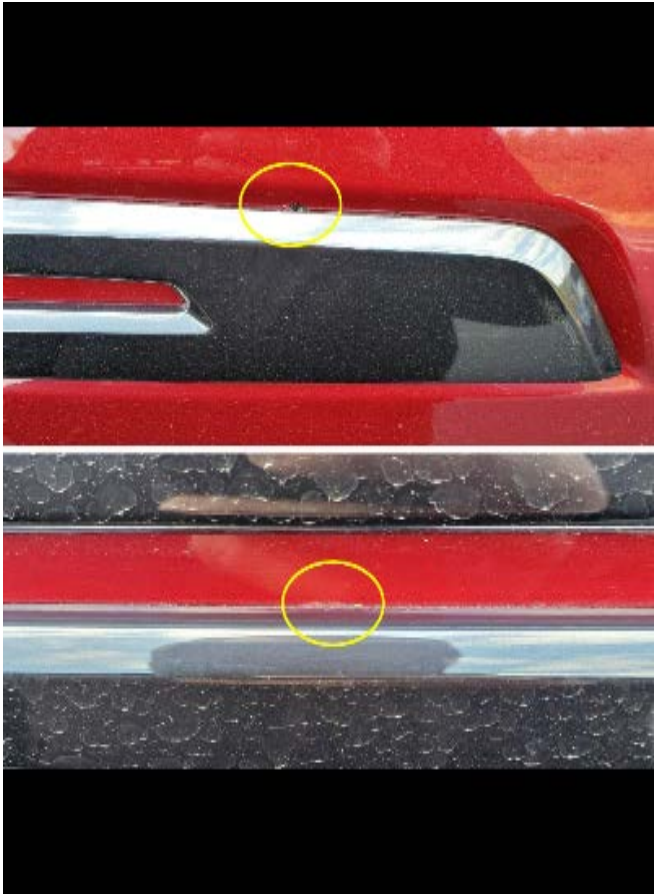Involved Region or Country	North America, Middle East, Iraq, Israel, Palestine, Columbia, Chile, Korea
Additional Options (RPOs)	
Condition	 <p style="text-align: right; font-size: small;">5969025</p> <p>Some customers may comment on seeing paint peeling, or chipping on the liftgate, where the black/chrome applique attaches.</p>
Cause	The cause of the condition may be interference contact between the applique and the painted surface.
Correction	Replace the rear closure center applique, the emblem applique (gray and green parts) and refinish liftgate as necessary.

Service Procedure

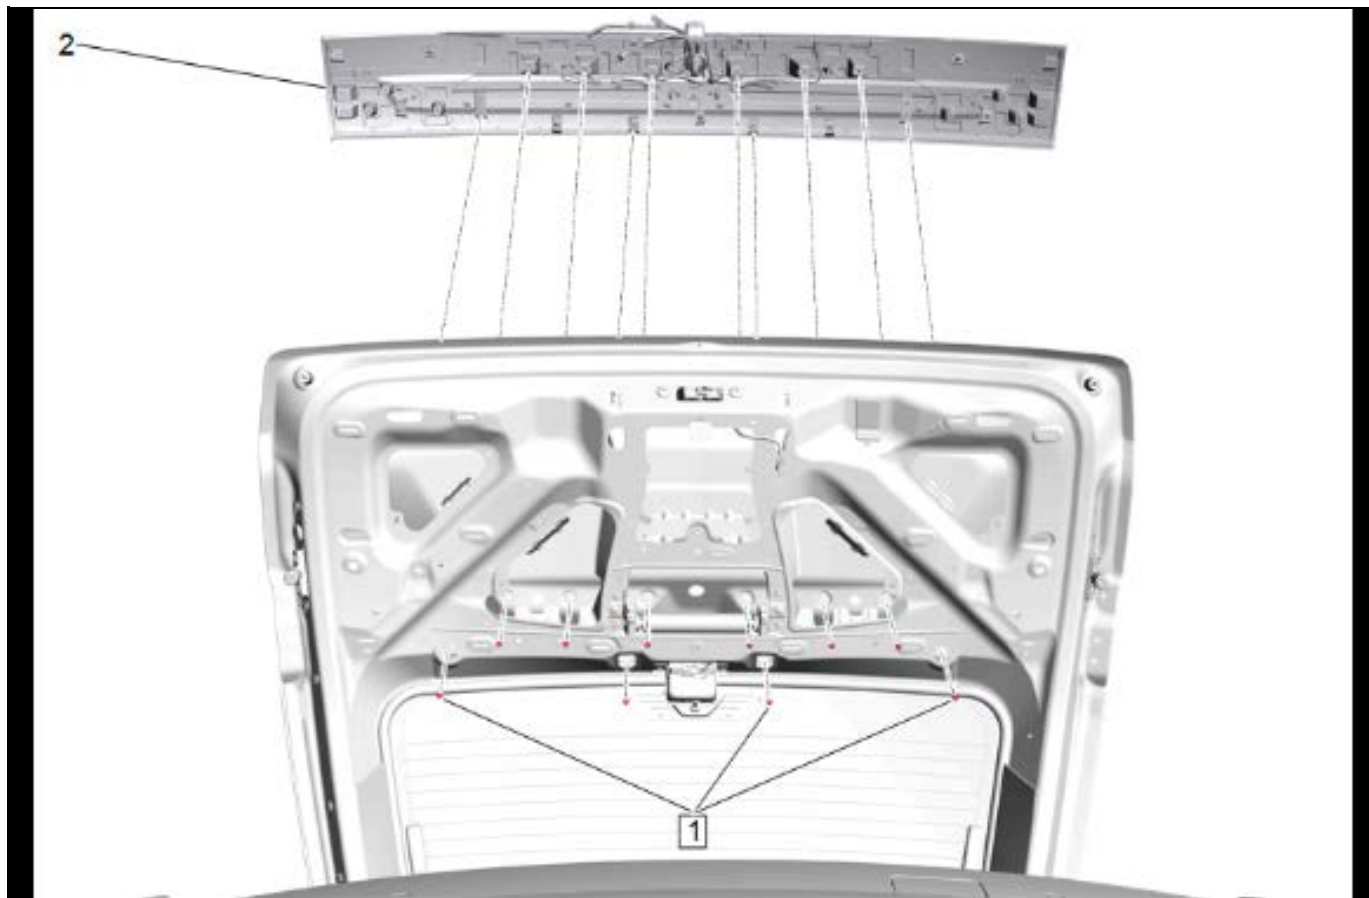


5580426

1. Remove the rear closure center applique assembly (2). Refer to *Rear Closure Center Applique Replacement* in the Service Manual.

Note: Refer to the latest revision of the GM Approved Refinish Materials book to identify the paint systems you may use that have been engineered to meet GM standards.

The latest revision of the GM Approved Refinish Materials booklet is located on the Genuine GM Parts website at www.genuinegmparts.com and within the "Unit Repair Manual/Specialty Publication" section of GM Service Information (SI).



2. Complete a partial paint repair to the affected location(s) of the liftgate. Refer to *Basecoat/Clearcoat Paint Systems* in the Service Manual.

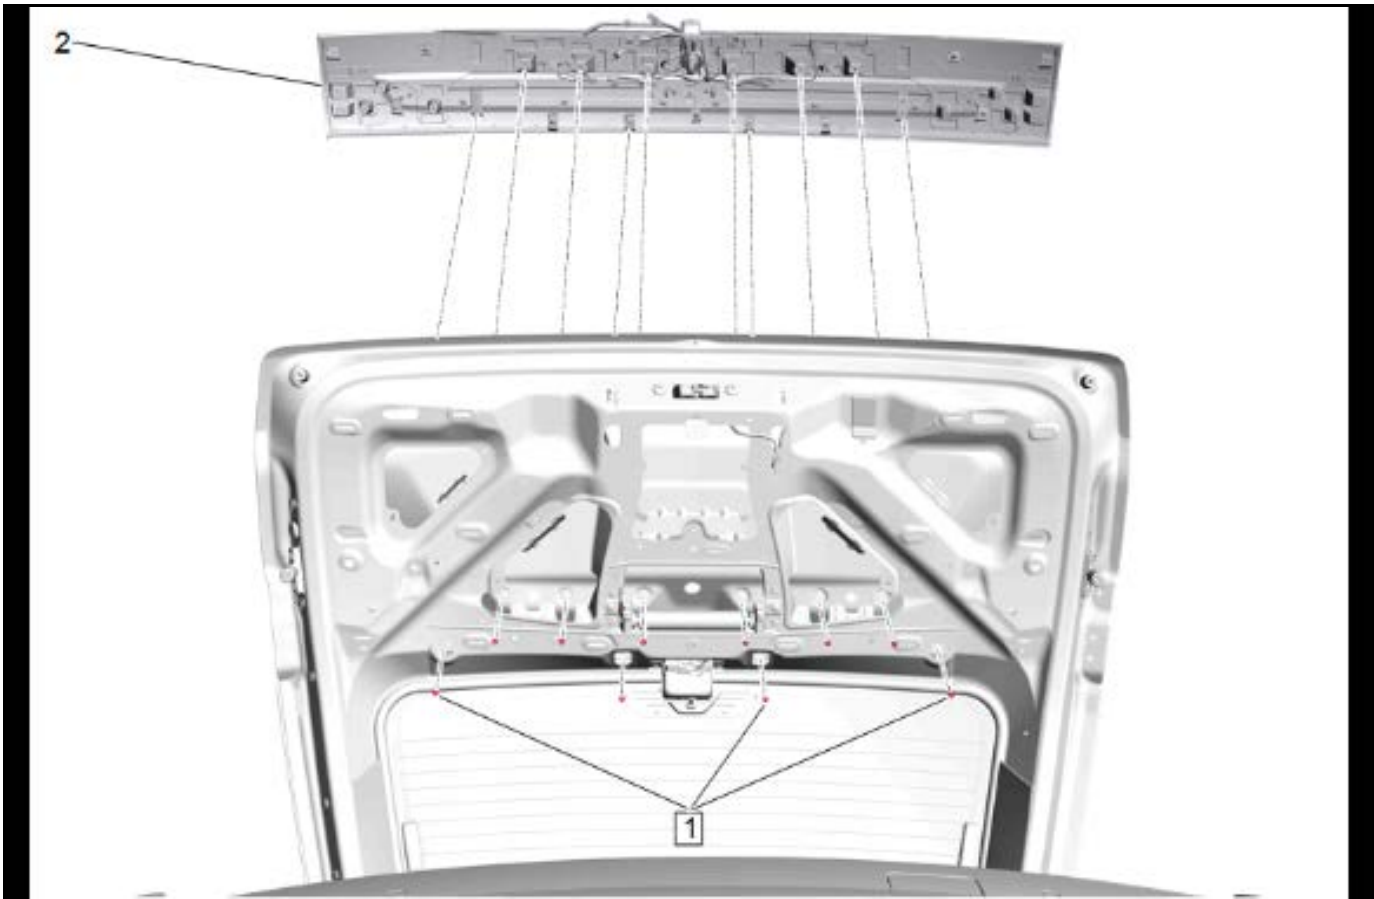

5580426

- 3. Replace the rear closure center applique assembly (2). Refer to *Rear Closure Center Applique Replacement* in the Service Manual.

 Tip: The applique kit will **replace both the grey and green part shown below**, as an assembly.

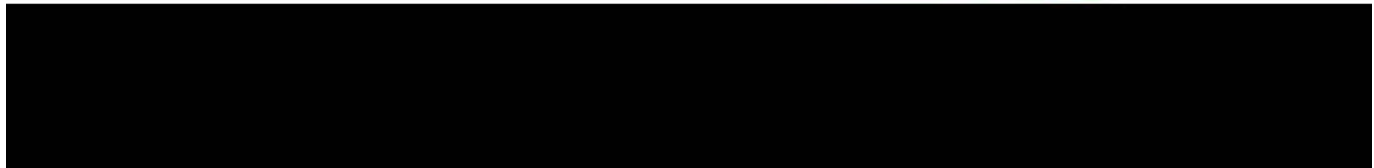

5985319

Parts Information

Causal Part	Description	Part Number	Qty
N/A	APPLIQUE KIT-RR CLSR CTR	86823363	1

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
1444754	Liftgate Panel Partial Refinish Color/Clear Coat	Use Published Labor Operation Time
1011320	Rear Closure Center Applique Replacement	

Version	1
Modified	Released January 19, 2023

