



TECHNICAL SERVICE BULLETIN

Classification: KS22-006	Reference: NTB23-001	Date: January 4, 2023
-----------------------------	-------------------------	--------------------------

THE VEHICLE ALARM SOUNDS WHEN UNLOCKING AND/OR OPENING THE DOORS WITH THE INTELLIGENT KEY

APPLIED VEHICLES: 2022 Pathfinder (R53)
APPLIED DATES: Built before October 18, 2021

IF YOU CONFIRM

The customer states that the vehicle security system (alarm) may inadvertently sound when unlocking and/or opening any of the vehicle's doors with the Intelligent Key.

ACTION

1. Confirm the current BCM hardware part number.

HINT: This number is the hardware number on the outside of the BCM, and can also be found with C-III plus.

2. If the current hardware part number is 284B1-6TA0E, replace the BCM with the part listed in the **PARTS INFORMATION**.

HINT: If the current part number is not 284B1-6TA0E, this bulletin does not apply. Please refer to the ESM for further diagnostic information.

- Refer to the ESM: **ELECTRICAL & POWER CONTROL > BODY CONTROL SYSTEM > REMOVAL AND INSTALLATION > BCM (BODY CONTROL MODULE) > Removal and Installation**
- After replacing the BCM, perform **ADDITIONAL SERVICE WHEN REPLACING BCM**.
 - Refer to the ESM: **ELECTRICAL & POWER CONTROL > BODY CONTROL SYSTEM > BASIC INSPECTION > ADDITIONAL SERVICE WHEN REPLACING BCM > Work Procedure**

IMPORTANT: The purpose of **ACTION** (above) is to give you a quick idea of the work you will be performing. You **MUST** closely follow the entire **ESM PROCEDURE** as it contains information that is essential to successfully completing this repair.

Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. **NOTE:** If you believe that a described condition may apply to a particular vehicle, **DO NOT** assume that it does. See your Nissan dealer to determine if this applies to your vehicle.

PARTS INFORMATION

DESCRIPTION	PART NUMBER	QUANTITY
BCM	284B1-6TA1A	1 As needed

CLAIMS INFORMATION

Submit a Primary Part (PP) type line claim using the following claims coding:

DESCRIPTION	PFP	OP CODE	SYM	DIA	FRT
Replace Body Control Module	(1)	RD94AA	ZE	32	(2)

- (1) Reference the electronic parts catalog and use the Body Control Module (284B1-*****) as the Primary Failed Part (**PFP**).
- (2) Reference the current Nissan Warranty Flat Rate Manual and use the indicated Flat Rate Time (**FRT**).

AMENDMENT HISTORY

PUBLISHED DATE	REFERENCE	DESCRIPTION
January 4, 2023	NTB23-001	Original bulletin published