

Reference	SSM75903
Models	New Range Rover / L460 New Range Rover Sport / L461
Title	Water leak in the cabin which can wet the headlining, grab handles or carpet.
Category	Body
Last modified	17-Jan-2023 00:00:00
Symptom	105000 Roof Options
Attachments	Image 17.pdf (Image 17.pdf) Image 21.pdf (Image 21.pdf)

Content

Issue:
Jaguar Land Rover is investigating customer reports of a water leak in the cabin which can wet the headlining, grab handles or carpet.

Cause:
Seam sealant cracking between roof panels beneath the roof rail mounting covers. This in turn can cause water to run down the headlining through the A/B/C pillars to the carpet.

Action:
Remove the roof rail mounting cover above the area of the water leak as shown in attachment image 1.

Apply any of the JLR recommended black PU sealants listed in 'TOPIX section 501-25A' to the green dotted line area as shown in attachment image 2.

Ensure the sealant is not applied to the area shown with the red dotted line in image 2 to allow for water drainage.

Thank you for your assistance in this matter.

anBhdHRlcnM7MjAyMy0wMS0xOFQxNDowMzo0NC42NzZaOzEzNi4yMjYyNTluODU7