

<b>Reference</b>	SSM75918
<b>Models</b>	Defender / L663 Discovery / L462 Discovery Sport / L550 New Range Rover Evoque / L551 Range Rover / L405 Range Rover Sport / L494 Range Rover Velar / L560
<b>Title</b>	18MY ONWARDS - CHECK ENGINE (AMBER) AND POOR CABIN HEATING - 2L AJ20 P4 - DTC P0128-00
<b>Category</b>	Engine
<b>Last modified</b>	17-Jan-2023 00:00:00
<b>Symptom</b>	402000 Cooling System Concerns
<b>Content</b>	<p><u>Issue:</u> JAGUAR LAND ROVER is investigating customer reports, Engine Management Light (EML) on and poor cabin heating. Diagnostic Trouble Code (DTC) P0128-00 Coolant Thermostat (Coolant Temperature Below Thermostat Regulating Temperature) is also present in the Powertrain Control Module (PCM).</p> <p><u>Cause:</u> Unknown at this time.</p> <p><u>Action:</u> Please carry out the following;</p> <ul style="list-style-type: none"> <li>-Confirm the vehicle symptoms as reported.</li> <li>-Replace the Thermostat Housing as per TOPIx WSM section: 303-03 ENGINE COOLING - INGENIUM I4 2.0L PETROL.</li> <li>-Take a sample of coolant in a (150 ml) sample bottle.</li> <li>-The following item must be locally sourced: 1x 150 ml sample bottle using Sundry Code ZZZ999.</li> <li>-Raise an ePQR, quoting this SSM, along with the repair. Please hold onto the parts replaced and coolant sample, as per the warranty policy (30 days), as engineering may request these parts for return.</li> </ul> <p>Thank you in advance for your assistance with this matter.</p>

anBhdHRicm7MjAyMy0wMS0xOFQxNDowMTozMS4xMDIaOzEzNi4yMjYyNTluODU7