

WNR0 Workshop campaign- Check high-voltage system coolant distributor and replace if necessary

WNR0 Workshop campaign- Check high-voltage system coolant distributor and replace if necessary

ID Number	WNR0
Models	Taycan (Y1A/Y1B/Y1C)
Model Years	2022
VIN list	Attached
Number of Affected VINs	15
Issue Description	<p>Due to temporary contamination of the laser welder, the water jacket on the high-voltage system coolant distributor may have been welded incorrectly on the affected vehicles.</p> <p>This can result in leakage in the high-voltage system coolant distributor. When a sufficient coolant loss is detected, the error message "Cooling system malfunction. Visit workshop" is displayed in the instrument cluster.</p> <p>To prevent this, the water jacket must be checked for correct welding and the high-voltage system coolant distributor replaced if necessary.</p>
What Dealers Should do	<p>Please arrange for this measure to be carried out as soon as possible on affected vehicles. As of the time of this posting, the repair is immediately available. Parts can be ordered via PPL as normal.</p>
TI Number	No. 218-22

Required parts

No parts are required for the check.

Part number	Designation	Quantity/vehicle	Parts return*
-------------	-------------	------------------	---------------

WNR0 Workshop campaign- Check high-voltage system coolant distributor and replace if necessary

V04015009	Coolant distributor	1 piece	No
WHT002287B	O-ring	3 pieces	No

*The parts must be stored until such time as the related warranty or campaign claim has been credited. If a barcode is generated with the credit note, the affected part must be sent to Porsche AG as usual. If no barcode is generated with the credit note, the part can go directly into the remanufactured parts process or be scrapped.

Warranty processing

Validity:

This workshop campaign will be carried out up to December 29, 2027 and will be closed on that date.

Please note that warranty claims can only be processed before this date.

Scope 1:

Damage Code	WNR0 66 000
Repair Code	1
Labor time	84 TU

Scope 2:

Damage Code	WNR0 66 000
Repair Code	2
Labor time	653 TU

Please enter the campaign carried out in the warranty and maintenance booklet for the vehicle.

Customer mobility

If requested, mobility for the affected customer is to be ensured with a suitable replacement vehicle.

Please invoice this additional service again via WWS with the campaign scope.