

WLM6 Workshop campaign - Check brake lines on the front axle and replace them if necessary

WLM6 Workshop campaign - Check brake lines on the front axle and replace them if necessary

ID Number	WLM6
Models	911 (992) 718 Boxster / 718 Cayman (982)
Model Years	2020 - 2021
VIN List	Attached
Number of Affected VINs	3,340
Issue Description	<p>There is a possibility that the brake lines on the front axle between the brake caliper and brake hose were damaged during the production process on the affected vehicles.</p> <p>If this is the case, corrosion can occur at the brake lines over the service life.</p> <p>As a result, the brake lines on the left and right of the affected vehicles must be checked and, depending on the outcome, reworked or replaced.</p>
What Dealers Should do	<p>Please arrange for this measure to be carried out as soon as possible on affected vehicles. As of the time of this posting, the repair is immediately available. Parts can be ordered as normal via PPL.</p>
TI Number	No. 197-20

Required parts and materials

Information: Please note that the scopes 1-16 are test and rework scopes and no parts or materials are required.

Vehicles with campaign scopes 17 to 26 and 29 to 38:

Part number	Designation	Quantity/vehicle	Parts return*
-------------	-------------	------------------	---------------

WLM6 Workshop campaign - Check brake lines on the front axle and replace them if necessary

V04015006D	Brake line on front axle, left "Basic" equipment (M No. A8C) Front disc brake, standard (M No. 1LS)	1 piece	No
or			
V04015006E	Brake line on front axle, right "Basic" equipment (M No. A8C) Front disc brake, standard (M No. 1LS)	1 piece	No
or			
V04015006F	Brake line on front axle, left "S" equipment (M No. A8F) Front disc brakes, stan- dard (M No.: 1LS/1LR)	1 piece	No
or			
V04015006G	Brake line on front axle, right "S" equipment (M No. A8F) Front disc brakes, stan- dard (M No.: 1LS/1LR)	1 piece	No
or			
V04015006H	Brake line on front axle, left "Basis/S" equipment Front PCCB disc brake (M No. 1LQ/1 LX) Front PSCB disc brake (M No. 1ZP/1LZ)	1 piece	No
or			

WLM6 Workshop campaign - Check brake lines on the front axle and replace them if necessary

V04015006I	Brake line on front axle, right "Basis/S" equipment Front PCCB disc brake (M No. 1LQ/1 LX) Front PSCB disc brake (M No. 1ZP/1LZ)	1 piece	No
------------	---	---------	----

Vehicles with campaign scopes 27, 28, 39 and 40:

Part number	Designation	Quantity/vehicle	Parts return*
V04015006J	Brake line on front axle, left	1 piece	No
or			
V04015006K	Brake line on front axle, right	1 piece	No

Vehicles with campaign scopes 41 to 45:

Part number	Designation	Quantity/vehicle	Parts return*
V04015006D	Brake line on front axle, left "Basic" equipment (M No. A8C) Front disc brake, standard (M No. 1LS)	1 piece	No
V04015006E	Brake line on front axle, right "Basic" equipment (M No. A8C) Front disc brake, standard (M No. 1LS)	1 piece	No
or			
V04015006F	Brake line on front axle, left "S" equipment (M No. A8F) Front disc brakes, standard (M No.: 1LS/1LR)	1 piece	No
V04015006G	Brake line on front axle, right	1 piece	No

WLM6 Workshop campaign - Check brake lines on the front axle and replace them if necessary

"S" equipment (M No. A8F)
Front disc brakes, standard (M No.: 1LS/1LR)

or

V04015006H Brake line on front axle, left 1 piece No

"Basis/S" equipment
Front PCCB disc brake (M No. 1LQ/1 LX)
Front PSCB disc brake (M No. 1ZP/1LZ)

V04015006I Brake line on front axle, right 1 piece No

"Basis/S" equipment
Front PCCB disc brake (M No. 1LQ/1 LX)
Front PSCB disc brake (M No. 1ZP/1LZ)

Vehicles with campaign scope 46 :

Part number	Designation	Quantity/vehicle	Parts return*
V04015006J	Brake line on front axle, left	1 piece	No
V04015006K	Brake line on front axle, right	1 piece	No

* The parts must be stored until such a time as the related warranty or campaign claim has been credited . If a barcode is generated with the credit note, then the affected part must be sent to Porsche AG in the usual way. If no barcode is generated with the credit note, the part can go directly into the remanufactured parts process or be scrapped.

Required materials (usually already available in the Porsche Dealer):

Part number	Designation	Quantity/vehicle
00004321086	Brake fluid, 30-litre container	Quantity after Required (per vehicle approx. 0.5 liters is required)

Warranty processing

Validity:

This workshop campaign will be carried out up to September 15, 2027 and will be closed on that date.

Please note that warranty claims can only be processed up to this date.

Scope 1: Checking brake lines

- 718 Boxster / 718 Cayman (982)
- 991 (992)

Damage Code	WLM6 66 000
Repair Code	1
Labor time	35 TU

Scopes 2 and 3: Checking brake lines and reworking them on one side

- 718 Boxster / 718 Cayman (982)
- 911 (992) with standard wheel bolts or wheel bolts with anti-theft protection (M No. 1PA) or (M No. 1PD)
- 911 (992) with wheels with central wheel lock (M No. 1PJ)

Damage Code	WLM6 66 000
Repair Code	1
Labor time	45 - 60 TU

Scopes 4 and 16: Checking brake lines and reworking them on both sides

- 718 Boxster / 718 Cayman (982)
- 911 (992) with standard wheel bolts or wheel bolts with anti-theft protection (M No. 1PA) or (M No. 1PD)
- 911 (992) with wheels with central wheel lock (M No. 1PJ)

Damage Code	WLM6 66 000
Repair Code	1
Labor time	55 - 79 TU

Scope 17 to 28: Checking brake lines and replacing them on one side

- 718 Boxster / 718 Cayman (982)
- 911 (992) with standard wheel bolts or wheel bolts with anti-theft protection (M No. 1PA) or (M No. 1PD)
- 911 (992) with wheels with central wheel lock (M No. 1PJ)

Damage Code	WLM6 66 000
-------------	-------------

WLM6 Workshop campaign - Check brake lines on the front axle and replace them if necessary

Repair Code 2
Labor time 136 -175 TU

Scope 29 to 40: Checking brake lines, reworking them on one side and replacing them on one side

- 718 Boxster / 718 Cayman (982)
- 911 (992) with standard wheel bolts or wheel bolts with anti-theft protection (M No. 1PA) or (M No. 1PD)
- 911 (992) with wheels with central wheel lock (M No. 1PJ)

Damage Code WLM6 66 000
Repair Code 2
Labor time 137 - 176 time units

Scope 41 to 46: Checking brake lines and replacing them on both sides

- 718 Boxster / 718 Cayman (982)
- 911 (992) with standard wheel bolts or wheel bolts with anti-theft protection (M No. 1PA) or (M No. 1PD)
- 911 (992) with wheels with central wheel lock (M No. 1PJ)

Damage Code WLM6 66 000
Repair Code 2
Labor time 146 - 186 time units

Please enter the campaign carried out in the warranty and maintenance booklet for the vehicle.

Customer mobility

If requested, mobility for the affected customer is to be ensured with a suitable replacement vehicle.
Please invoice this additional service again via WWS with the campaign scope.