



# Service Bulletin

Bulletin No.: 22-NA-217

Date: January, 2023

## TECHNICAL

**Subject: Malfunction Indicator Lamp (MIL) Illuminated - DTC P0442 Set**

**This bulletin replaces PIP5862. Please discard PIP5862.**

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Buick	Encore	2021	2022			LE2	
Chevrolet	Trax						

<b>Involved Region or Country</b>	North America
<b>Condition</b>	Some customers may comment that the MIL is illuminated. Some technicians may find DTC P0442 set in the Engine Control Module.
<b>Cause</b>	This condition may be caused by an error in the plastic welding process of the purge canister, which creates a small leak in the EVAP system
<b>Correction</b>	Smoke test the purge canister. – If the purge canister fails the leak test then replace the purge canister.

**Important: Service agents must comply with all International, Federal, State, Provincial, and/or Local laws applicable to the activities it performs under this bulletin, including but not limited to handling, deploying, preparing, classifying, packaging, marking, labeling, and shipping dangerous goods. In the event of a conflict between the procedures set forth in this bulletin and the laws that apply to your dealership, you must follow those applicable laws.**

## Service Procedure

Refer to *Evaporative Emission Canister Replacement* in *SI*.

## Parts Information

Causal Part	Description	Part Number	Qty
N/A	CANISTER, EVAP EMIS	42763670	1

## Warranty Information

For vehicles repaired under the Emission coverage, use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
4088808*	Diagnosis and Testing	0.5
Add	Evaporative Emission Canister Replacement for P0442	0.9
Add	To Drain and Fill Fuel	0.4
Add	With Propeller Shaft	0.4

\*This is a unique Labor Operation for Bulletin use only.

Version	1
Modified	Released January 20, 2023

