



Preliminary Information

PIT5964 2022 HUMMER EV Exterior Lamps Flicker Every 8 seconds Along With A Momentary Pause Of The Windshield Wipers And Turn Signal Click Clack Sound Effect With Current Or History DTC: P0607

Proactive

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
GMC	HUMMER EV	2022	All	All	All	All

Involved Region or Country	North America
Condition	Some customers may experience one or more of the following concerns: 1. Exterior Lamps Flicker every 8 seconds 2. Momentary pause of the windshield wipers 3. Momentary pause of the turn signal indicator clicking sound effect 4. Current or history code: P0607
Cause	The cause of this concern could be a K219 Lighting control module that is in boot mode (Logic Locked)

Correction:

Do Not replace the lightening control module to resolve this concern. Engineering has developed new software to address this concern which will be released soon.

A temporary workaround has been developed to resolve the concern:

1) Perform a 12v battery disconnect/reconnect following Document ID: 5840812 in Service Information . After this procedure restart the vehicle and verify condition has been corrected and the DTC is no longer set

2) On rare occasions the 12v disconnect/reconnect may not resolve the problem or clear the DTC. If that is the case, the K219 Lighting control module will have to replaced. The module is on parts restriction, please refer to the latest version of [PIT5858](#) for ordering the part.

Warranty Information

For vehicles repaired under the warranty, use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor operation	Description	Labor Time
5486368	12V SYSTEM RESET	0.2 Hr.

Version History

Version	1
Modified	01/04/2023 - Created on.



GENERAL MOTORS

© 2023 General Motors. All Rights Reserved.