



Preliminary Information

PIP5788B DTC P2635 Set

Models



Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Silverado 1500	2021	All	All	5.3 L82 L84 6.2 L87	All
GMC	Sierra 1500	2021	All	All	5.3 L82 L84 6.2 L87	All

Involved Region or Country	North America
Condition	Some customers may comment that the SES lamp is illuminated or was illuminated and turned off, with no drivability concerns. During inspection Technician may notice DTC P2635.
Cause	Unknown at this time

Correction:

If you encounter a vehicle with the above DTC, use GDS and save the freeze frame records.

use the freeze frame to duplicate the concern with GSD looking at fuel system data to see what the pressure is at the time of failure

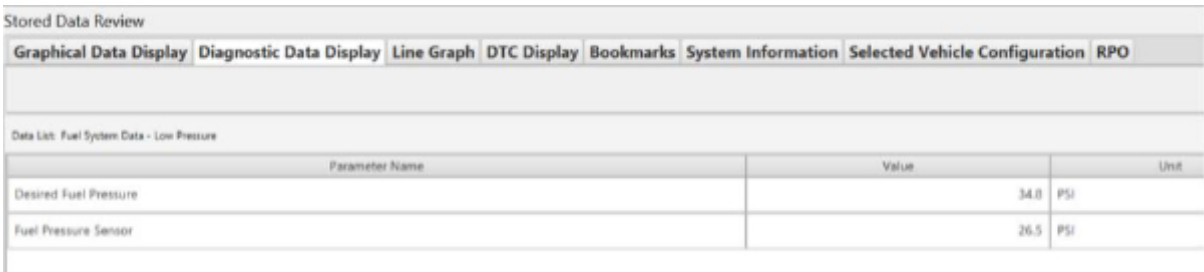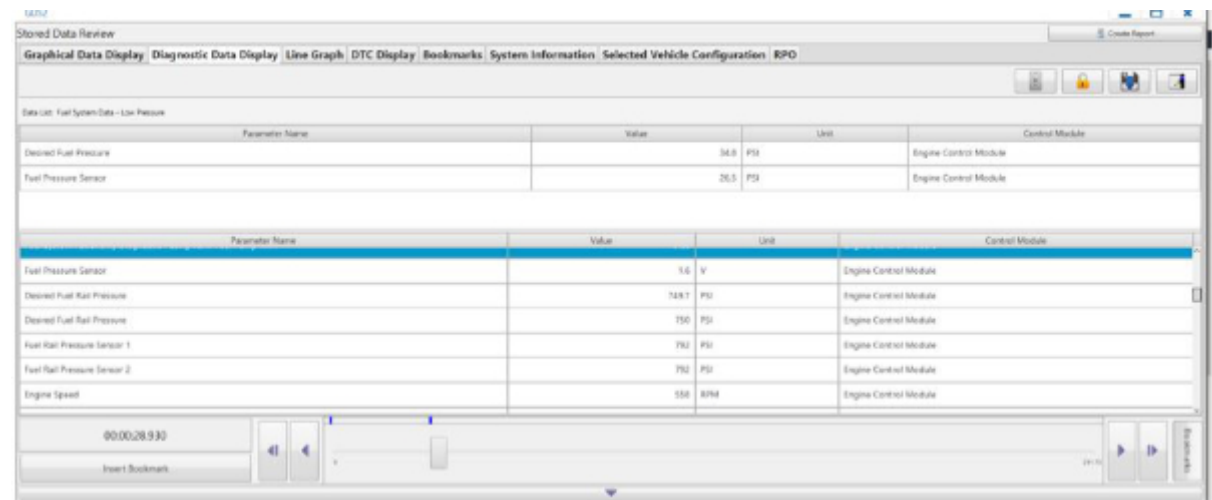

If the DTC sets with low pressure follow the applicable diagnostic flow chart in service information for further diagnosis and repair.

If the diagnostic does not isolate the concern, and the fuel pressure was above desired, replace fuel feed pipe (fuel line between the high-pressure fuel pump and chassis line), clear the codes, and return it to the customer.

If replacing the fuel pipe only set up a T AC case. As always if further help is needed contact TAC .

If the truck has already had the fuel jumper replaced, do not replace again. Follow diagnostic flow chart to ensure a different issue has not developed.

If it does not isolate the concern, clear codes only and return to the custom.

Engineering knows about the concern and is working on a more permanent service procedure.

Please attach a copy of the freeze frame records and a screen shot of actual and desired low side fuel pressure to the work order.

This PI will be updated as information is gathered.

Version History

Version	1
Modified	03/16/2021 - Created on. 04/15/2021 - updated the correction statement 10/04/2021- update to add start a TAC case



© 2023 General Motors. All Rights Reserved.