

GPOP - Issue Review System

Part Number: 6XV20TX7A\$,

Part Description: HANDLE, Seat Release (WL75 3R FOLD HANDLE)

Issue Description: WL75 3rd row Release Handle - Prior to replacing the handle for headrest not folding. Pull handle and inspect the release cable and handle, cable should be fully installed and with retention finger/tab present to correct this concern. If retention finger/tab is present, use a tool to fully seat ball fitting into side of handle and past the finger/tab avoiding partial installation. Cycle handle several times to ensure fitting did not come loose.