



Condition

ATTENTION:

**THIS IS A TECH TIP, NOT A TECHNICAL BULLETIN.
TECH TIPS ARE NOT ASSOCIATED WITH WARRANTY CLAIMING.**

Applicable Vehicles

Model(s)	Year	Eng. Code	Trans. Code	VIN Range From	VIN Range To
Atlas, Atlas Cross Sport, Jetta, Taos, Tiguan	2022 - 2023	All	All	All	All

Revision Table

Instance Number	Published Date	Version Number	Reason For Update
2069480/1	2/9/2023	57-23-01TT	Original publication.

Technical Background

The customer may complain that KESSY door lock and/or unlock features from the exterior door handles are inoperative. The key(s) may still work via FOB functions (button press).

One or both of the following DTCs may be present in Address 09:

DTC	Description
B1479F0	Remote control key 1 Movement sensor faulty
B147AF0	Remote control key 2 Movement sensor faulty

Service

Replacement of the key remote is not necessary. Remove the battery from the affected key(s) and leave removed for 20 seconds. Re-install the battery, and verify operation of KESSY lock and unlock.

Additional Information

© 2023 Volkswagen Group of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Volkswagen Group of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.