

MAS003382 RU 22-05

RAPID UPDATE

FROM: Maserati TSO
TO: Maserati Network



PERSONAL SERVICE LAB

MASTERS OF CARE

Rapid Update 570 Trunk Latch Cover Check

TECHNICAL SERVICE OPERATIONS



DATE: January 6 2023

Certain Maserati MY22-MY23 Ghibli (M157), Levante (M161), and Quattroporte(M156) MY21 listed in MODISCS+ are involved in a Rapid Update concerning the ECM Software Update to check the integrity of the trunk latch cover.

This action is needed to verify that the trunk latch cover is properly engaged, avoiding any potential detachment.

We remind you that all the Rapid Updates must be performed within the first workshop visit, regardless of the Mandatory setting set in Modis, as required by Maserati policies.

Also, for vehicles in Stock Dealer / PDI, it is necessary to carry out all action operations before delivery to the end customer, as required by the White Book and explicitly reported in the Pre-delivery checklist.

Please read and review this bulletin first before starting the procedure.
Contact your Regional AfterSales Manager (RAM) or the Technical Support Helpdesk if you have any questions. (MaseratiTechsupport@maserati.com)

Thank You for your continued support and cooperation.

Maserati Americas
Aftersales Dept.

Technical Procedure



All images shown in this bulletin are for illustrative purposes only

1. Always check ModisCS+ to see if the vehicle is involved in this action and if it has not been previously performed.
2. Open the trunk lid.
3. Using a suitable Teflon wedge, release the rear liftgate lock cover on LH and RH side then remove the trunk latch cover:



4. Check the integrity of the cover clips:
 - a. If the cover clips are not broken, the check can be considered OK and the cover can be refitted.
 - b. If one or more cover clips are broken, the check is NOT OK and the component must be replaced.



5. The operation is completed.

Spare parts

In case of NOT OK, please order the following PN:

Spare parts	Pn	Q.ty
LOCK COVER	670042409	1

Warranty Claim

Fill in the relative Warranty Claims as follows:

Description	Code
Rapid Update Number	570
Warranty Code	23
Fault Code	063
Component Code	9.24.061
Operation Code	
M15x Check	9.24.061.A (0,05 h)
M15x Check + Replacement	9.24.061.B (0,10 h)
M161 Check	9.26.007.A (0,05 h)
M161 Check + Replacement	9.26.007.B (0,10 h)