

Technical Service Bulletin



00 Invalid DTCs are stored; all functions work normally (Audi Q4)

00 23 63 2067842/2 February 13, 2023. Supersedes Technical Service Bulletin Group 00 number 22-59 dated August 23, 2022, for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
Q4 e-tron quattro, and Q4 Sportback e-tron quattro	2022 – 2023	All	Not Applicable
Q4 e-tron RWD	2023		

Condition

REVISION HISTORY		
Revision	Date	Purpose
2	-	Revised <i>Condition</i> (updated DTC table)
1	08/23/2022	Initial publication

Customer States:

No customer concerns; it is found during PDI or any other diagnostic work.

Workshop findings:

The following DTCs may be entered in the vehicle:

Diag. Address	DTC	Description	Symptom	Status
0019	B114DF2	Multifunction steering wheel control module	1376305	passive/intermittent or active/static
	B131D29	Sirens / alarm horn for anti-theft warning system, implausible signal	267032	passive/sporadic
	B163002	Predictive route data signal error	9371914	passive/intermittent or active/static
	B1AF9F0	HV coordinator charging not initiated	8515664	passive/intermittent

Technical Service Bulletin



	<i>B1CA2F1</i>	Charge cover A activation locking error	<i>8516873</i>	passive/intermittent
	<i>B200000</i>	Control module faulty	<i>8556801</i>	passive/intermittent or active/static
	<i>C1249F6</i>	Function limitation due to safety functions for charging management (mechanical)	<i>8516406</i>	passive/intermittent
	<i>P0CF400</i>	Control Pilot Circuit Range/Performance	<i>8516368</i>	passive/sporadic
	<i>P1CC300</i>	External charging infrastructure malfunction	<i>8516354</i>	passive/intermittent
	<i>P1DCB00</i>	External charging infrastructure not ready for charging, charge socket A	<i>8516869</i>	passive/intermittent
	<i>U012200</i>	ESP no communication	<i>8398618 or 8398619</i>	passive/intermittent
	<i>U029200</i>	Lost Communication With Drive Motor Control Module 'A'	<i>8398626</i>	passive/intermittent or active/static
	<i>U105400</i>	Information electronics control module 1, no communication	<i>2244723</i>	passive/intermittent
	<i>U112100</i>	Data bus missing message	<i>848472065 or 8515586 or 528917 or 540677</i>	passive/intermittent
	<i>U112200</i>	Data bus implausible message	<i>8557314</i>	passive/intermittent



	<i>U112300</i>	Data bus error value received	<i>8471814</i>	passive/intermittent
	<i>U14FE00</i>	Secure Onboard Communication, signature verification failed	<i>8491266</i>	passive/intermittent or active/static
	<i>U14FF00</i>	Secure Onboard Communication, signature creation failed	<i>8491267</i>	passive/intermittent
	<i>U15FA00</i>	EgoMaster, input data error	<i>8540417</i>	passive/intermittent
	<i>U163300</i>	HVLM vehicle to grid setup timeout	<i>8516355</i>	passive/intermittent
	<i>U164200</i>	Ethernet Emergency Call Module no communication	<i>2502759</i>	passive/intermittent
	<i>U164300</i>	Ethernet Rearview Camera System Control Module no communication	<i>2494569</i>	passive/intermittent or active/static
	<i>U164600</i>	Ethernet antenna module no communication	<i>2502842</i>	passive/intermittent
	<i>U166300</i>	Ethernet application server 3 for system 1 infotainment no communication	<i>2498824</i>	passive/intermittent
	<i>U173E00</i>	Occupant detection function limitation due to implausible message	<i>8511746</i>	passive/intermittent
	<i>U195A00</i>	Light control module has adapted safe condition	<i>937984</i>	passive/intermittent or active/static



C002	U14FF00	Secure Onboard Communication, signature creation failed	8491267	passive/intermittent
	U175D00	Software error, recovery update via basic setting required	1796 or 1797 or 1798	passive/intermittent or active/static
8123	U175D00	Software error, recovery update via basic setting required	479232	passive/intermittent
	P1CB500	Plug and Charge Communication error while installing a vehicle certificate	8495361	passive/intermittent or active/static
	P1CB600	Plug & Charge vehicle certificate installation failed	8495362	passive/intermittent or active/static
8124	U111100	Function limitation due to missing message	8603057	passive/intermittent or active/static
	U175D00	Software error, recovery update via basic setting required	8603057	active/static
C002	U112300	Data bus error value received	4194347	passive/intermittent or active/static
8116	U112300	Data bus error value received	4194347	passive/intermittent or active/static

Technical Background

Due to various changes in production and ODIS software, various faults may be displayed or stored in the diagnostic tester even though there is no problem in the vehicle.

Production Solution



Not applicable.

Service

No repair is available at this time.

1. Do not perform any repairs. Any repairs for this concern may be denied.



The DTC codes listed above **do not** require a TAC ticket for repair authorization reporting.

Warranty

This TSB is informational only and not applicable to any Audi warranty.

Additional Information

All part and service references provided in this TSB (**2067842**) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2023 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.