# **Technical Service Bulletin**



94 Headlight warning is displayed, DTC C119811 is stored in D6/D7 headlight module

94 23 62 2067655/2 February 14, 2023. Supersedes Technical Service Bulletin Group 94 number 22-56 dated August 1, 2022, for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
Q3	2022	All	Not Applicable

### Condition

REVISION HISTORY				
Revision	Date	Purpose		
2	-	Revised images (Removed unneeded images)		
1	08/01/2022	Initial publication		

#### **Customer states:**

A headlamp warning is displayed in the instrument cluster. One of the low beam lamps may be inoperative.

#### **Workshop findings:**

The following DTC is stored in the Left and/or Right light control module, A31/A27 (address word D6/D7):

• DTC C119811 - Low Beam Headlamp Bulb, short.

# **Technical Background**

Insufficient application of soldering paste to various LED's inside the headlight.

## **Production Solution**

Process optimization at manufacturer.

## **Service**

Inspect the wiring and connections at the affected headlight to ensure no other root cause is present. If the wiring is ok, replace the affected headlight.

# Warranty

# **Technical Service Bulletin**



Claim Type:	<ul> <li>110 up to 48 Months/50,000 miles.</li> <li>G10 for CPO covered vehicles – Verify Owner.</li> </ul>				
	<ul> <li>If the vehicle is outside of any warranty, this Technical Service Bulletin is informational only.</li> </ul>				
Service Number:	9415				
Damage Code:	0040				
Labor Operations:	Inspect 1 lamp (wiring and connections)	9415 0199	Max 50 TU		
	Inspect 2 lamps (wiring and connections)	9415 0299	Max 100 TU		
	DTC required for both headlight modules in GFF				
	Remove and install 1 headlight	9415 1950	See SRT with associated operations		
	Remove and install 2 headlights	9415 2050	See SRT with		
	DTC required for both headlight modules in GFF		associated operations		
Diagnostic Time:	GFF	0150 0000	Time stated on the diagnostic protocol (Max 100 TU)		
	Road test prior to the service procedure	No allowance	0 TU		
	Road test after the service procedure	No allowance	0 TU		
Claim Comment:	As per TSB 2067655/2				
	the decrease of the first of the decrease of t	. A !! 14/	- l'ala a an al Dua a a di una a		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

# **Required Parts and Tools**

Always check with your Parts Department and/or ETKA for the latest information and parts bulletins.			
Part Number	Part Description	Quantity	
	Fasteners, Bolts, Nuts, and Screws as needed per the Repair Manual	See ETKA/ELSA	

## Page 2 of 3

#### © 2023 Audi of America, Inc.

# **Technical Service Bulletin**



See ETKA	Left Headlight	01 (if applicable)
See ETKA	Right Headlight	01 (if applicable)

### **Additional Information**

All parts and service references provided in this TSB (207655) are subject to change and/or removal. ©2023 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.