

Technical Service Bulletin

Mazda North American Operations
Irvine, CA 92618-2922



Subject: PASSENGER SEATBELT REMINDER TURNS ON WITHOUT A PASSENGER SEATED IN THE VEHICLE	Bulletin No.: 08-001/23
	Last Issued : 02/16/2023

BULLETIN NOTES

APPLICABLE MODEL(S)/VINS

Mexico Spec.:

2018-2023 CX-5 vehicles with VINs lower than JM3 KF**** ** 598752 (Produced before Mar. 31, 2022)

NOTE: This concern occurs on vehicles equipped with leather seats, but without seat warmers or power seats.

DESCRIPTION

Some vehicles may turn on the passenger seatbelt reminder, even though there is no passenger seated in the vehicle.

This concern may be caused by the passenger sensor being too sensitive. To eliminate this concern, the passenger sensor has been modified.

Customers experiencing this concern should have their vehicle repaired using the following repair procedure.

REPAIR PROCEDURE

1. Verify the customer concern.
2. Replace the passenger seat cushion with a modified part according to the instructions on MGSS online (FRONT SEAT CUSHION TRIM REMOVAL/INSTALLATION)
3. Verify the repair.

PARTS INFORMATION

Parts Number	Description	Qty.	Notes
KD2C-88-11XC	CUSHION (R), FRT SEAT-SUB	1	Japan built
KE08-88-807 02	LEVER (R), LIFTER	1	[R] Mexico spec. only
TK48-88-1G5 02	KNOB (R), KNUCKLE	1	[R]
KD45-88-585	CLIP	2	[R]

[R]: Replacement parts

Page 1 of 2

CONSUMER NOTICE: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/ equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical--including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.

WARRANTY INFORMATION**NOTE:**

- This warranty information applies only to verified customer complaints on vehicles eligible for warranty repair.
- This repair will be covered under Mazda's New Vehicle Limited Warranty term.
- Additional diagnostic time cannot be claimed for this repair.

Warranty Type	A
Symptom Code	65
Damage Code	9W
Part Number Main Cause	****-88-11X*
Quantity	1
Operation Number / Labor Hours:	XXW97ARX / 0.8 Hrs.

CONSUMER NOTICE: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/ equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical---including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.