

SSM 51358

2021-2022 Bronco - A/C Working Intermittently And DTC P0532

Some 2021-2022 Bronco vehicles may encounter a concern of the A/C working intermittently and DTC P0532 stored in the PCM. If this symptom is exhibited have the technician inspect connector C1062 at the pressure transducer for corrosion and/or terminal fretting. The pins in this connector may be worn creating the intermittent A/C operation. Technicians can perform a wiggle test at this connector to duplicate the issue. If the concern can be duplicated with a wiggle test, replace the pigtail service connector and the pressure transducer sensor and install dielectric grease inside both to prevent reoccurrence.