

# WNK5 Workshop Campaign – Exchanging spreader device (actuator)

---

## WNK5 Workshop Campaign - Exchanging spreader device (actuator)

ID Number	WNK5
Models	718 (982) 911 (992)
Model Years	2021-2022
VIN List	Attached
Number of Affected VINs	135
Issue Description	<p>There is a possibility that the spreader device (actuator) for the electric parking brake does not meet the required specifications on the affected vehicles.</p> <p>If this is the case, cup springs can potentially break in the spreader device over a longer service life, and this can result in function restrictions when the electric parking brake is actuated.</p> <p>To prevent this from happening, the spreader device (actuator) on the affected vehicles must be replaced with a spreader device that meets the required specifications.</p>
What Dealers Should do	<p>Please arrange for this measure to be carried out as soon as possible on affected vehicles. <b>As of the time of this posting (2/14/23), the repair is immediately available.</b></p> <p><b>Parts can be ordered via PPL as needed.</b></p>
TI Number	<a href="#">No. 140-22</a>
Customer Letter	To be sent at a later date.

## Parts required

Valid for Scope 1 - 4

WNK5 Workshop Campaign – Exchanging spreader device (actuator)

Part number	Designation	Quantity/vehicle	Parts return*
V04015004AC	Left spreader device (actuator)	1 piece	No
9A700704400	Fit bolt	2 pieces / 4 pieces	No
N 10456004	Internal hexagon round countersunk screw	2 pieces / 4 pieces	No
Additionally required for vehicles with Scope 1			
99907340201	Cheese head bolt (M12 x 1.5 x 72)	2 pieces / 4 pieces	No
Additionally required for vehicles with Scope 2			
9A700758500	Cheese head bolt (M12 x 1.5 x 85)	2 pieces / 4 pieces	No
Additionally required for vehicles with Scope 3 and 4			
V04015004AB	Right spreader device (actuator)	1 piece	No

Valid for Scope 5 - 8

Part number	Designation	Quantity/vehicle	Parts return*
V04015004AB	Left spreader device (actuator)	1 piece	No
9A700704400	Fit bolt	2 pieces / 4 pieces	No
N 10456004	Internal hexagon round countersunk screw	2 pieces / 4 pieces	No
PAF100829	Hexagon-head bolt (combination)	4 pieces / 8 pieces	No
Additionally required for vehicles with Scope 5			
PAF007586	Cheese head bolt (M12 x 1.5 x 95)	2 pieces / 4 pieces	No
Additionally required for vehicles with Scope 6			
PAF911837	Cheese head bolt (M12 x 1.5 x 115)	2 pieces / 4 pieces	No
Additionally required for vehicles with Scope 7 and 8			

V04015004AC	Right spreader device (actuator)	1 piece	No
-------------	-------------------------------------	---------	----

\*The parts must be stored until such time as the related warranty or campaign claim has been credited. If a barcode is generated with the credit note, the affected part must be sent to Porsche AG as usual. If no barcode is generated with the credit note, the part can go directly into the remanufactured parts process or be scrapped.

## Warranty processing

Validity:

This workshop campaign will be carried out up to February 2nd, 2028 and will be closed on that date. Please note that warranty claims can only be processed up to this date.

Scope 1 -6:

Damage Code	WNK5 66 000
Repair Code	2
Labor time	126TU - 207TU

Please enter the campaign carried out in the Warranty and Maintenance booklet for the vehicle.

## Customer mobility

If requested, mobility for the affected customer shall be ensured with an adequate replacement vehicle. Please invoice this additional service again via WWS with the campaign scope.

---

### Attachments

- [1. VIN\\_List\\_Report\\_WNK5\\_2023-02-14 With Scopes.xlsx](#)
- [2. VIN\\_List\\_Report\\_WNK5\\_2023-02-14\\_V2.xlsx](#)