

Accessory Raised Air Intake

Customer Voice:

- A customer may complain of a rattling type noise from the accessory fitted raised air intake tube.

Technical Description:

- Vehicles may experience loads that exceed that of the upper A-Pillar bracket, causing the plastic bracket to crack.

Status:

- A metal upper bracket to retain the air tube has been released for service to address this concern.
- SSM 75865 has been published to provide instructions and part number of the new bracket.
- Should a customer express a concern, please refer to this SSM.
- Some early released parts of the LR180431 bracket had the wrong width bracket (narrower) supplied. Using the narrower upper bracket would cause a rattle concern. All parts have been corrected to include the correct width metal bracket to directly replace the plastic bracket.

20-23MY Defender

