

## Body/Chassis – Water Leak From Roof Area

---

### Customer Voice:

- A customer may complain that water is leaking into the vehicle cabin.


### Technical Description:


- Water may enter the vehicle cabin through a roof body seam or gap in the panoramic roof opening panel cassette sealant.

### Status:

- **SSM 75903** has been published to address a potential water leak path through the roof body seam.
- Roof water leaks should be able to be repaired without the need to remove the complete roof cassette assembly.


22-23MY Range Rover, 23MY Range Rover Sport SVR

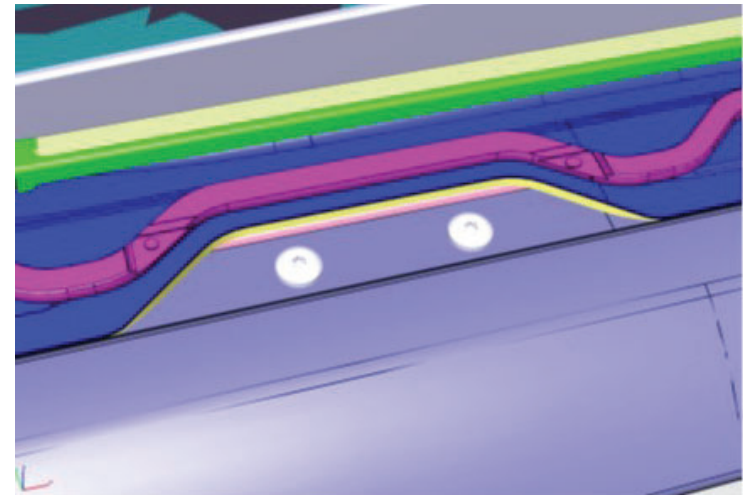


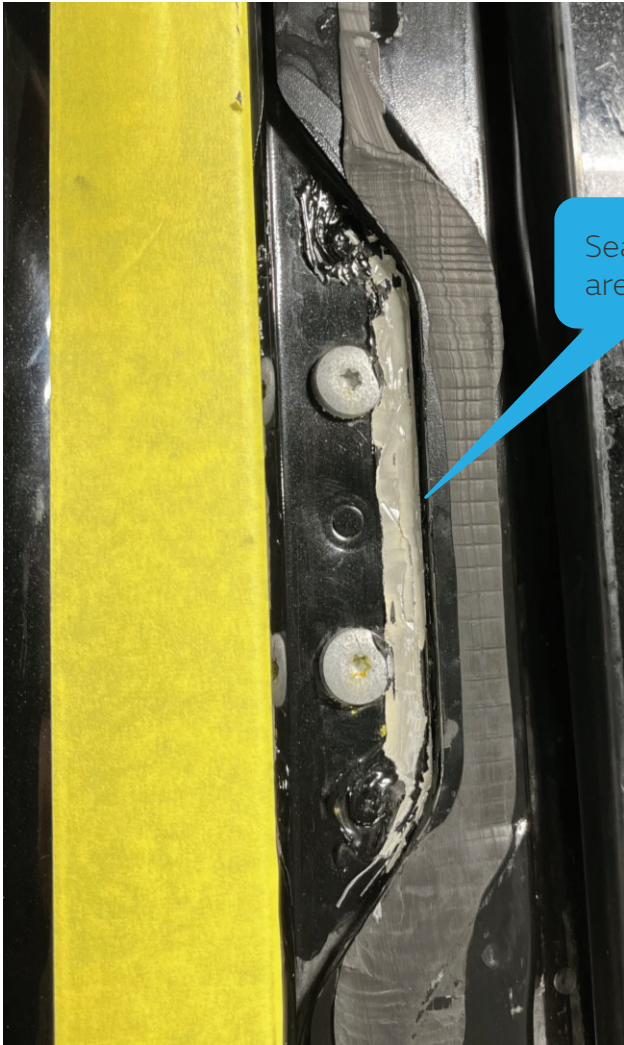

Seal this area

The area must be clean and dry before applying the PU adhesive.

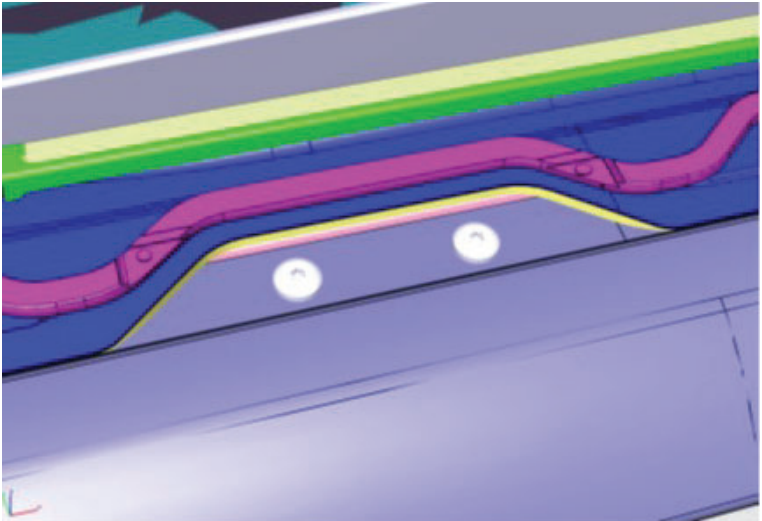

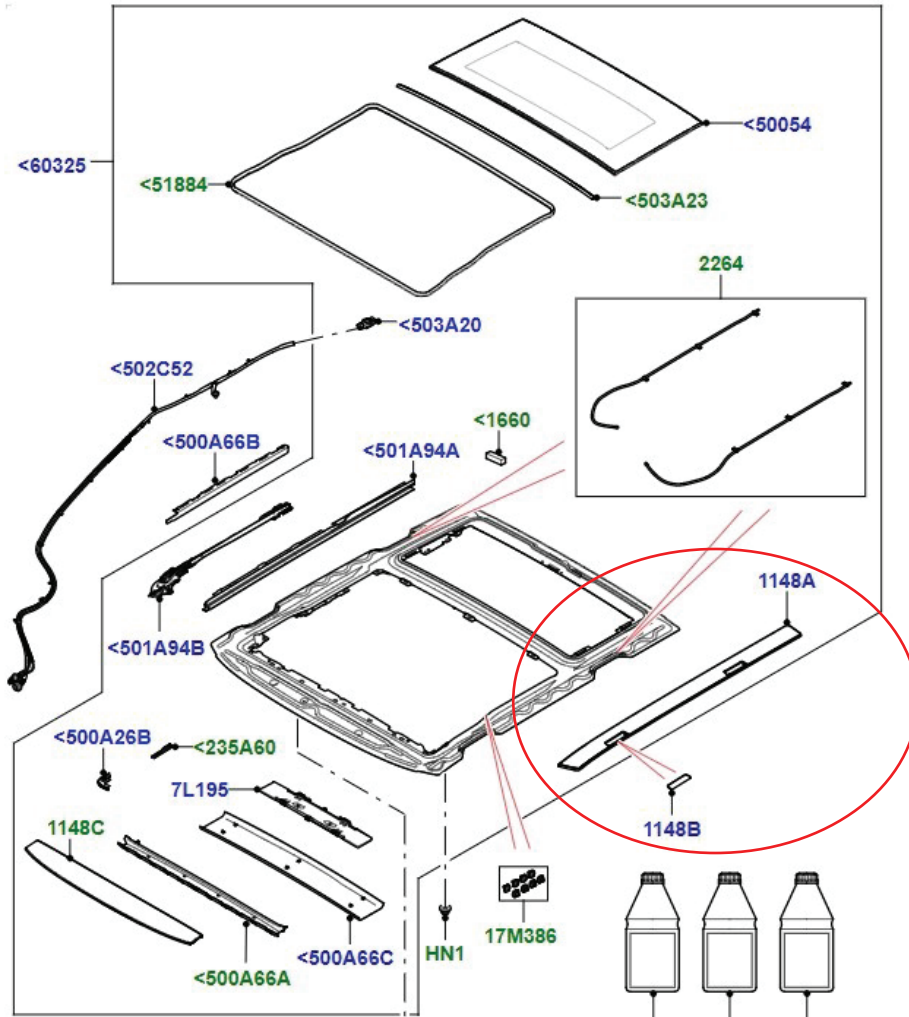

- The roof ditch trim is bonded in place.
- It needs to be cutout to be removed.
- Any gap in the roof opening panel cassette sealant can be resealed by removing just the trim panel.

