

Bulletin No.: PIP5885A Published date: 02/7/2023

Preliminary Information

PIP5885A GF9 9T45/50/60/65 Transmission Fluid Leak

<u>Models</u>

Brand:	Model:	Model Years:	VIN:		Engine	Transmissions:
			from	to	Engine:	fransmissions.
Buick	Encore GX	2022 - 2023	All	All	All	МЗF
Cadillac	XT5	2022 - 2023	All	All	All	M3G M3W
Cadillac	ХТ6	2022 - 2023	All	All	All	M3G M3W
Chevrolet	Blazer	2022 - 2023	All	All	All	МЗТ МЗV
Chevrolet	Malibu	2022	All	All	All	МЗЕ
Chevrolet	Trailblazer	2022 - 2023	All	All	All	M3F
Chevrolet	Traverse	2022 - 2023	All	All	All	МЗТ МЗV
GMC	Acadia	2022 - 2023	All	All	All	M3G M3W
GMC	Terrain	2022 - 2023	All	All	All	M3U

Involved Region or Country	North America & NA Exports
	Some customer may comment that transmission fluid is leaking from the vehicle with vehicle build date between May 1 2022 and November 30 2022.
Cause	The transmission fluid leak may be fluid remaining in the top pockets of the trans assembly due to incomplete cleaning during assembly, and/or may be an overfill concern resulting in a fluid leak from the vent/fill cap, that now may be seen underneath the vehicle.

Correction:

Check vehicle build date.

If between May 1, 2022 and November 30 2022, then clean any transmission fluid seen, adjust fluid level to ensure is at the correct level, and install dye and road test to re-check for completed repair.

If not within build dates, then proceed with Service Manual Fluid Leak diagnosis.

* Note* If leak is found to be from an axle seal, note where the leak is from, axle seal to case, or rubber to axle, picture if possible to attach to the RO, and/or to the TAC case, if a TAC case is opened.

Warranty Information

For vehicles repaired under the Powertrain coverage, use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
8480958	Clean residual transmission fluid. Add dye and road test a minimum of 15 miles to get transmission fluid temperature to operating temperature. Use black light to inspect for dye.	0.8 Hrs.

Version History

Version	2
Mand Cond	10/11/2022 - Created on. 02/07/2023 - Modified to add additional build date time.



GENERAL MOTORS

© 2023 General Motors. All Rights Reserved.