

## **Preliminary Information**

## PIP5901 Transfer Case Clutch Set Up and Installation

<u>Models</u>

| Brand:                                   |                           | Model:                                       | Model Years: | VIN: |     | Engine  | Transmissions: |  |
|--|---------------------------|--|--------------|------|-----|---------|----------------|--|
|  |                           |  |              | from | to  | Engine: | mansmissions.  |  |
| Chevrolet                                | Silverado 2500 HD/3500 HD |  | 2020 - 2023  | All  | All | All     | MGM MGU        |  |
| GMC                                      | Sierra 2500 HD/3500 HD    |  | 2020 - 2023  | All  | All | All     | MGM MGU        |  |
| Involved Region or Country North America |                           |  |              |      |     |         |                |  |
| Additional Options (RPO)                 |                           | NQH  |              |      |     |         |                |  |
| Condition                                |                           | Transfer case clutch set up tools do not fit |              |      |     |         |                |  |
| Cause                                    |                           | New tool being developed.                    |              |      |     |         |                |  |

When trying to perform clutch pack set up for the HD NQH the tool currently called out, DT-48213-5 Transfer Case Clutch Pack Height Measuring Adapter, is not available.

There is no work around, so for transfer cases needing clutch pack related repairs, you will need to replace the complete assembly.

Please make sure to get the clutch identifier from the tag of the new transfer case assembly that needs to be loaded into the transfer case control module.

For vehicles with shudder/bind on turns in auto 4wd where clutches are suspect, please see the latest version of TSB 19-NA-136.

For these types of complaints, it has been noted that changing the fluid then driving the vehicle, shifting between 2wd and 4wd about 10 times then changing the fluid a second time has the best result. (Currently TSB revision being discussed)

For information on tool availability or tool related questions please contact <u>km@service-solutions.com</u> or call 1-800-GM-Tools

This PI will be deleted when the tools are received at dealers.

Parts Information

| Part Number | Description                    | Quantity |
|-------------|--------------------------------|----------|
| 85120263    | Transfer case (NQH) MGM or MGU | 1        |

## Warranty Information

For vehicles repaired under the Powertrain coverage, use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

| Labor Op | Description                        | Time                     |  |  |
|----------|------------------------------------|--------------------------|--|--|
| 8421160  | Transfer Case Assembly Replacement | Use Published Labor Time |  |  |

## Version History

| Version  | 1                       |
|----------|-------------------------|
| Modified | 02/13/2023 - Created on |



GENERAL MOTORS

© 2023 General Motors. All Rights Reserved.