

RAPID UPDATE

FROM: Maserati TSO

TO: Maserati Network



MASTERS OF CARE

Rapid Update 599

Grecale Premium Alarm System (LSA) OPT – Volumetric Alarm Deactivation



DATE: FEBRUARY 21 2023

Certain Maserati Grecale (M182) MY23 listed in MODISCS+ are involved in a Rapid Update to temporarily deactivate the Volumetric Alarm.

Due to a regression via the new ITM SW 2.05, an improper behavior of the Volumetric Alarm could affect the Premium Alarm System (LSA opt) which could cause an abnormal power draw and potentially drain the 12V battery.

This action consists of a new vehicle configuration writing, to **temporarily** deactivate the Volumetric Alarm to avoid abnormal battery drain. We remind you that this new configuration will not affect the functionality of the Standard Alarm System (perimeter alarm). See Details on page 2 for the main differences between Perimeter vs Volumetric Alarm.

This action is temporary. A new ITM SW will soon be released to correct the concern and reactivate the volumetric feature.

We remind you that all Rapid Updates must be performed at the first entry of the vehicle into the workshop, regardless of the Mandatory setting set in Modis, as required by Maserati policies.

Also, for cars in Stock Dealer / PDI, it is necessary to perform all campaign operations before delivery to the end customer, as prescribed by the White Book and explicitly reported in the Pre-delivery checklist

Please read and review this bulletin first before starting the procedure.

Contact your Regional AfterSales Manager (RAM) or the Technical Support Helpdesk if you have any questions. (MaseratiTechsupport@maserati.com) Thank You for your continued support and cooperation.

Maserati Americas
Aftersales Dept

Alarm Feature Overview

STANDARD ALARM SYSTEM*

- Perimeter Protection
- Doors/Trunk Opening Effraction Detection
- Acoustic Indication via Horn Beep (No Siren)
- Deterrence Led Indication
- App Feedback
- External Lights Blinking

PREMIUM ALARM SYSTEM (OPT LSA)

- Volumetric/Tilting Protection
- Acoustic Indication with Siren

* The new vehicle configuration is not affecting the **Standard Alarm System** functionality. The Maserati Grecale will continue to be protected by the Standard Perimetral Protection.

Technical Procedure




All images shown in this bulletin are for illustrative purposes only

Please follow these steps sequentially DO NOT pull the fuse before performing the **Vehicle Configuration**.

1. Always check ModisCS+ to see if the vehicle is involved in this action and if it has not been previously performed.
2. Write the new "**Vehicle Configuration**" (VC) through the MD-EVO.
3. Accessing the Rear Distribution Unit (**RDU**), remove the F14 10A fuse, indicated in the picture below.

NOTE: Please keep the fuse removed until a new Service action has been released to reactivate the volumetric feature.

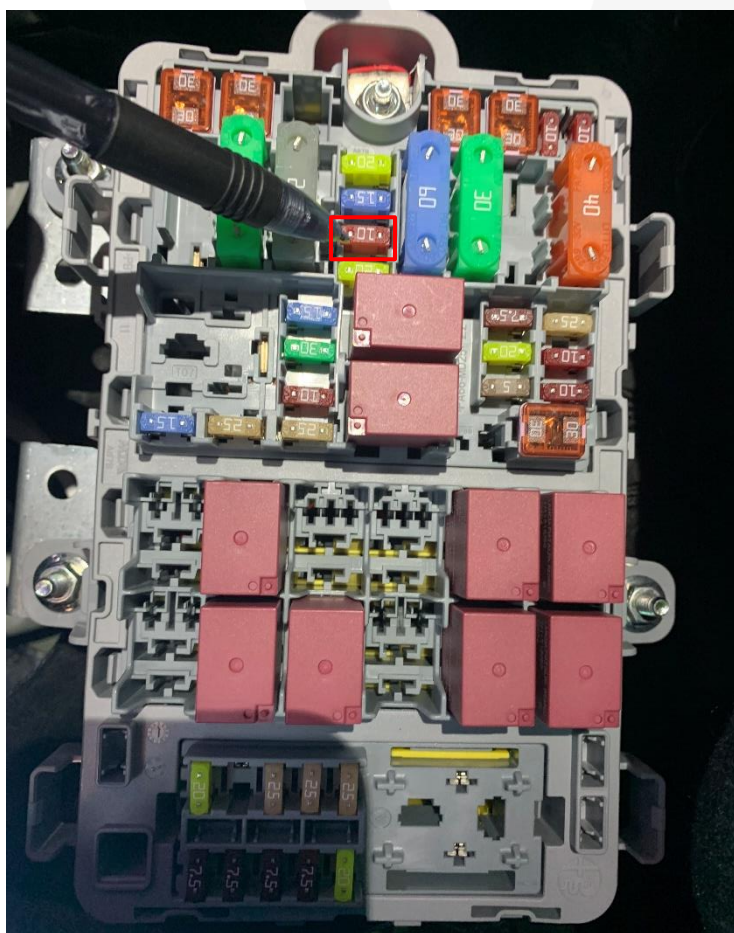

3. The operation is completed.

Warranty Claim

Fill in the relative Warranty Claims as follows:

Description	Code
Campaign Number	599
Warranty Code	23
Fault Code	063
Component Code	8.61.035
Operation Code	8.61.035.B (0,20h)