

MAS003413 RU 22-10

**RAPID UPDATE**

FROM: Maserati TSO

TO: Maserati Network



**Maserati**

PERSONAL SERVICE LAB

MASTERS OF CARE

TECHNICAL SERVICE OPERATIONS

# Rapid Update 574 MC20 - Interior handle replacement



DATE: FEBRUARY 14 2023

Certain Maserati MC20 (M240) MY22 MY23 are involved in a Rapid Update regarding the interior door pull-handle.

This intervention is necessary because a limited number of cars have been fitted with handles that do not meet the high Maserati quality standards and may present fraying with the passage of time. The phenomenon is due to the use, on this limited lot, of a textile fabric that is not properly cauterized.

We remind you that all Rapid Updates must be performed at the first entry of the vehicle into the workshop, regardless of the Mandatory setting set in Modis, as required by Maserati policies.

Also, for cars in Stock Dealer / PDI, it is necessary to perform all campaign operations before delivery to the end customer, as prescribed by the White Book and explicitly reported in the Pre-delivery checklist.

Please read and review this bulletin first before starting the procedure. Contact your Regional AfterSales Manager (RAM) or the Technical Support Helpdesk if you have any questions. ([Maseratitechsupport@maserati.com](mailto:Maseratitechsupport@maserati.com))

Thank You for your continued support and cooperation.

Maserati Americas  
Aftersales Dept.

# Technical Procedure



All images shown in this bulletin are for illustrative purposes only

1. Always check ModisCS+ to see if the vehicle is involved in this action and if it has not been previously performed.
2. Disassemble the internal door panel according to the procedure in the workshop manual:

**a. 9.28.003.0 DOOR PANEL COVER RH 02**

3. Place the paneling (1) on the workbench, taking care to protect the inner part from all types of scratches and dirt and move the handle by unscrewing the additional two screws inside the paneling.



4. Then replace the standard handle with the new one, taking care to correctly reposition all the screws previously disassembled.
5. Perform the same procedure on the left side of the car, replacing both handles.

**a. 9.28.004.0 DOOR PANEL COVER LEFT 02**

6. Reassemble all removed parts following the removal procedure in reverse order.
7. The operation is complete.

## Spare parts

Order the correct kit per each vehicle VIN and color :

Spare parts	PN	QTY
KIT Handle (LH + RH) door black + grey	673015352	1
KIT Handle (LH + RH) black + grey + red	673015353	1
KIT Handle (LH + RH) black + grey + yellow	673015354	1
KIT Handle (LH + RH) black + leather	673015355	1
KIT Handle (LH + RH) black + blue	673015356	1
KIT Handle (LH + RH) black + blue	673015357	1
KIT Handle (LH + RH) lat black + grey	673015358	1

## Warranty Claim

Fill in the relative Warranty Claims as follows:

Description	Code
Campaign Number	574
Warranty Code	23
Fault Code	063
Component Code	9.28.009
Operation Code	9.28.009A(0.50h)