

<b>Subject</b>	The connection for the remote start/stop switch on Solitudes equipped with Onan generators is wired incorrectly. This is not a safety hazard but does prevent the generator from auto-shutdown.				<b>Number</b>	23-001
					<b>Date</b>	1/23/2023
					<b>Model</b>	2022/23 Solitude
					<b>Build Date</b>	2/28/22 - 12/12/22
<b>Circulate To:</b>	Service Manager	x	Parts Manager		Technician	x
	Warranty Admin	x	Sales Manager		Part Number (s)	N/A
<b>Concern:</b>	Wiring to the remote start/stop switch of the generator at the GenSet panel is wired incorrectly. During use, the generator must be unplugged to shut down. This is ONLY on Solitude units with factory installed generator package. Gen prep not affected.					
<b>Remedy:</b>	Rewire the switch correctly. Unplug the blade connectors and relocate to the correct position. No parts are required. A list of affected VIN's will be located on the dealer portal in the Announcements section.					
<b>Flat Rate:</b>	430018 - .3 allowed					

1. Disconnect battery leads and unplug the unit from shore power.
2. Locate the GenSet panel in the convenience center.
3. Remove the GenSet panel from the Convenience Center by removing the two retention screws.
4. Inspect the wiring and Compare to Figure A.
5. If wiring is incorrect, rewire the switch and hour meter as shown in Figure A.
6. Reinstall GenSet panel in the convenience center.
7. Reconnect the battery leads and test function.

