

23 MIL on, DTCs P008700, P008800, and/or P019100 stored in the ECM

23 23 57 2040752/11 March 3, 2023. Supersedes Technical Service Bulletin Group 23 number 20-55 dated October 6, 2020, for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment	
Q7 TDI	2009 – 2013			
A3 Sportback TDI	2010 – 2013	All	Not Applicable	

Condition

REVISION HISTORY			
Revision	Date	Purpose	
11	-	Revised Warranty (Updated Labor Operations)	
10	10/06/2020	Revised Required Parts and Tools (Added return line)	
9	11/19/2019	Revised <i>Warranty</i> (Added Claim Type)	

Customer states:

- MIL on.
- The vehicle either runs roughly or does not start.

Workshop findings:

One or more of the following DTCs is stored in the engine control module (ECM), J623 (address word 0001):

- DTC P008700 (Fuel rail/system pressure too low).
- DTC P008800 (Fuel rail/system pressure too high).
- DTC P019100 (Fuel rail pressure sensor "A" circuit range/performance).

Technical Background

 
Metallic particles in the high-pressure fuel pump may cause the condition.

Production Solution

Not applicable.

Page 1 of 9

^{© 2023} Audi of America, Inc.



Service



Before proceeding, perform all GFF diagnostic procedures and check all components to determine a root cause of the condition, including testing supply pressure to the high-pressure fuel pump (a low-pressure side) and checking for internal leakage from the injectors and N276 pressure regulating valve.

If there is no root cause found, use the following procedure to check for metallic particles in the high-pressure fuel pump.

Initial diagnosis of high-pressure fuel pump:

 Prepare to remove the N290 fuel metering valve by first cleaning the area around the valve then drying the area using compressed air (Figure 1). All debris must be removed from the area to ensure that no debris enters the fuel system and causes damage. More information is available in the Elsa at Repair Manual, Engine >> Fuel Supply System >> General Repair Information >> Clean Working Conditions.

2. Remove the N290 fuel metering valve, and inspect both the valve and valve bore for metallic particles (Figure 2).

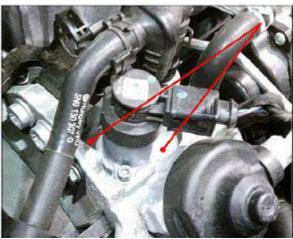


Figure 1. The area surrounding the N290 fuel metering valve.



Figure 2. N290 fuel metering valve and valve bore shown with and without metallic particles.

Page 2 of 9

© 2023 Audi of America, Inc.

3. If metallic particles are found:

- This bulletin applies.
- The high-pressure fuel pump and major • components of the fuel system will need to be replaced. Proceed to the next section for instructions.

If metallic particles are not found:

- This bulletin does not apply.
- Reinstall the N290 fuel metering valve using light • pressure. Before reinstalling, ensure that the valve is free of contaminants.
- Install and hand-tighten both M5 fasteners, ensuring that the threads are clean and dry (pretighten to 2 Nm, then to 6.5 - 7 Nm).



Before reinstalling the N290 fuel metering valve, check the O-rings for damage (Figure 3). If any damage is found, the high fuel pressure pump must be replaced outside of this bulletin.

To prevent damage to the O-rings during reinstallation of the valve, lubricate the O-rings with diesel fuel.


High-pressure fuel pump replacement and fuel system repair:


Before proceeding, check ElsaPro for the latest information and detailed instructions for the removal and replacement of the components listed in this TSB.

- Use suction pump VAS5226 to clean the fuel delivery unit and fuel tank. 1.
- 2. Fill the fuel tank with five liters of fresh diesel fuel.
- 3. Use suction pump VAS5226 to completely drain the fuel tank.
- 4. Replace the in-tank fuel pump.
- 5. Replace the suction jet pump.
- Following the instructions in the Elsa repair manual, replace the following components: 6.
 - High-pressure fuel pump (note that the supply and return line orientation for the HPFP may be reversed on updated pumps installed on vehicles manufactured before 05/25/2010).
 - High-pressure fuel lines.
 - Fuel rail (with both sensors included).
 - All fuel injectors.
 - Fuel return lines (overflow oil lines).
 - Fuel filter.
 - Fuel filter housing.
 - Auxiliary fuel pump.
- 7. After replacements are complete, then fuel the vehicle.
- Ensure that the fuel injector return line is properly seated and sealed. 8.


Page 3 of 9

 Figure 3. N290 fuel metering valve O-rings.

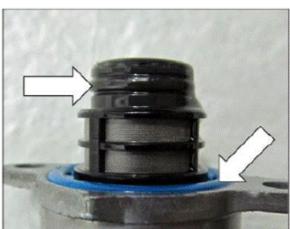



^{© 2023} Audi of America, Inc.

 

9. Using the VAS tester, perform the "Vent Fuel System" Guided Function. See Elsa at Repair Manual, Engine >> Fuel Supply System >> 20 Fuel Supply >> Fuel System, Bleeding for additional information.

Tip: If the test plan is unavailable through Guided Functions, switch to *Self Diagnosis* >> *Engine Electronics* >> *Basic Settings* >> *35*, and perform the basic settings three times consecutively. For UDS vehicles, perform basic settings for initial fueling.

- 10. Once the repairs are complete, then test drive the vehicle.
- 11. Inspect for fuel seepage at the fuel injector return line connector. If seepage is found, the condition must be corrected.

Claim Type:	• 110 – Verify Vehicle Warranty Coverage.			
	G10 for CPO Covered Vehicles – Verify Owner.			
	G14 - Verify Coverage in ElsaPro.			
	 If the vehicle is outside any warranty, this Technical Service Bulletin is informational only. 			
Service Number:	2374			
Damage Code:	0010			
Labor Operations:	abor Operations: For Q7:			
	Fuel bleed	2003 0750	See SRT with associated operations	
	Fuel tank cleaned	2010 2999	50 TU	
	Diesel fuel filter remove + reinstall	2034 1900	See SRT with associated operations	
	Supply line cleaned	2038 2999	10 TU	
	Return line cleaned	2039 2999	10 TU	
	2 electric fuel pump remove + reinstall	2066 2000	See SRT with associated operations	
	Suction jet pump remove + reinstall	2050 1901	See SRT with associated operations	
	2 distribution rail remove + reinstall	2373 2047	See SRT with associated operations	

Warranty

Page 4 of 9


© 2023 Audi of America, Inc.



		T	
	6 injector remove + reinstall	2340 2047	See SRT with associated operations
	High-pressure pump remove + reinstall	2374 1947	See SRT with associated operations
	For A3:	•	
	Fuel bleed	2003 0750	See SRT with associated operations
	Fuel tank cleaned	2010 2999	50 TU
	Diesel fuel filter remove + reinstall	2034 1901	See SRT with associated operations
	Supply line cleaned	2038 2999	10 TU
	Return line cleaned	2039 2999	10 TU
	Electric fuel pump remove + reinstall	2066 1900	See SRT with associated operations
	Electric fuel pump (aux) remove + reinstall	2066 1902	See SRT with associated operations
	Distribution rail remove + reinstall	2373 1912	See SRT with associated operations
	4 injector remove + reinstall	2340 2012	See SRT with associated operations
	Toothed belt remove + reinstall	1524 1912	See SRT with associated operations
	High-pressure pump remove + reinstall	2374 1962	See SRT with associated operations
Diagnostic Time:	GFF	0150 0000	Time stated on the diagnostic protocol
			(Q7: Max 80 TU) (A3: Max 70 TU)
	Road test prior to service procedure	No allowance	0 TU
	Road test after service procedure	0121 0004	10 TU

Page 5 of 9

 © 2023 Audi of America, Inc.



Claim Comment:

As per TSB 2040752/11

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Tip: Always verify Extended Emissions Warranty (EEW) coverage in ELSA.

UNote:

The Extended Emissions Warranty must cover all parts and labor, as well as the cost or provision of a loaner vehicle for warranty service lasting longer than 3 hours for, among other things, repairs to the entire fuel system, including the fuel pumps, high-pressure common rail, fuel injectors, and all sensors and actuators (DOJ 1st and 2nd Partial Consent Decrees, Appendix B, Section 3.9).

For A3: Always check with your Parts Department and/or ETKA for the latest information and parts bulletins.		
03L130755A	High-pressure fuel pump	01
03L130321	Fuel line	01
03L130089	Fuel rail (sensors)	01
03L130277A	Fuel injector	04
059130519	Seal ring (Fuel injector)	04
WHT000884	O-ring (Fuel injector)	04
03L130301	Pressure pipe	04
03L130301R		
03L130301B		
03L130301C		
059130216C	Tensioning plate (Injector)	04
03L130235S	Return Line	01
3C0127400C	Fuel filter/housing	01
1K0130307CE	Fuel line	01
03L201360G	Fuel line	01

Required Parts and Tools

© 2023 Audi of America, Inc.

Page 6 of 9



1K0130295AQ	Fuel line	01
1K0130307BK	Fuel line	01
5N0130307CC	Fuel line	01
1K0919050AB	Fuel delivery unit and fuel gauge sender	01
5N0906129B	Auxiliary fuel pump	01
See ETKA	Fasteners, Bolts, Nuts, and Screws as needed per the Repair Manual	See ETKA/ELSA

For Q7: Always check with your Parts Department and/or ETKA for the latest information and parts bulletins.		
059130755BT	High-pressure fuel pump	01
059130300EC	Fuel line set	01
N 90770201	Spring clip	02
N 90926401	Spring clip	01
4B0422379	Spring clip	04
7L6201906A	Fuel hose (return)	01
7L6201905	Fuel hose (supply)	01
7L6130295AC	Fuel line (return)	01
7L6130295AT	Fuel hose (supply)	01
7L6130295BB	Fuel hose (return)	01
059130300DF	1 set of fuel lines	01
059130310AK	Fuel line	01
059130089AM	Fuel rail (left)	01
059130090AQ (MY09-10) 059130090BR (MY11-12)	Fuel rail (right)	01
N 0138128	Seal ring (Fuel rail/fuel line)	02

Page 7 of 9

© 2023 Audi of America, Inc.



	1	1
059130131H (MY09-10) 059130218AF (MY11-12)	Fuel line/hose	01
059130309AT	Fuel line	01
059130277AM	Fuel injector	06
WHT000884	O-ring (injector)	06
059130241CD	Pressure pipe	06
059130216C	Tensioning plate (Injector)	06
059130312K	Fuel line	01
7L6127401H (MY09-10) 8T0127401A (MY11-12)	Fuel filter	01
059103113G	Sealing cap (Cylinder headcover)	06
7L6919088F (MY09-10) 7P6919088B (MY11-12)	Fuel supply module	01
4L0919715B (see ETKA) 4L0919715C (see ETKA) 4L0919715D (see ETKA)	Suction pump	01
8E0919133B	Seal ring (Fuel supply module)	02
7L6203491D	Fuel radiator	01
1K0906089C (MY09-10)	Auxiliary fuel pump	01
See ETKA	Fasteners, Bolts, Nuts, and Screws as needed per the Repair Manual	See ETKA/ELSA

Additional Information

More information on this system can be found in the following resources:

 
- Elsa: Engine >> Fuel Supply System >> General Repair Information >> Clean Working Conditions.
- Elsa: Engine >> Fuel Supply System >> 20 Fuel Supply >> Fuel System, Bleeding.

All parts and service references provided in this TSB (2040752) are subject to change and/or removal.

©2023 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property

Page 8 of 9

^{© 2023} Audi of America, Inc.



rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.

© 2023 Audi of America, Inc.

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.

Page 9 of 9