

QUARANTINE NOTICE

Reference number:	QN-42-1751	Issued: 24 March, 2023
Subject:	Examine Tyre Speed Ratings	
Model:	DBX707	
VIN Range:	Refer to the separately published list of affected Vehicle Identification Numbers (VINs)	
Applicable to:	All Dealers	
Distribute to:	After Sales Manager Executive Manager Service Manager Sales Manager	Warranty Staff Technician(s) Parts Staff

Reason for this Quarantine Notice

Aston Martin has found that some DBX707 vehicles may have incorrect speed rated tyres installed.

Do the procedure that follows to examine the speed rating of the tyres, and if necessary, install new tyres.

1. Examine the speed ratings on the outer edge of the tyres.
2. If the speed rating of the tyres are as follows, the vehicle has the correct tyres installed:

- Front Tyre: ZR22 (110Y)
- Rear Tyre: ZR22 (114Y)

If the speed ratings of all the tyres are correct, this procedure is complete.

Note: Figure 1 shows a rear tyre.



Figure 1

3. If the speed rating of the tyres are as follows, the vehicle has incorrect tyres installed.

- Front Tyre: R22 110Y
- Rear Tyre: R22 114Y

If the speed rating of a tyre is incorrect it must be replaced (refer to Part Data).

Note: Figure 2 shows a rear tyre.



Figure 2

Warranty Data

If one or more tyres must be replaced tick the add consequential parts check box on the claim form and select the Part Number or Part Numbers from Order History. If more than one tyre must be replaced claim for the applicable Labour time in the Lab Hrs Additional field on the claim form.

Procedure and Labour Time

Tier A

Description	Labour Time
Examine the Tyre Speed Ratings	0.10

Tier B

Description	Labour Time
Examine the Tyre Speed Ratings	0.10
Install a New Tyre	0.50

Part Data

Description	Part Number
Front Tyre (Pirelli Scorpion)	MY83-1508-EB
Rear Tyre (Pirelli Scorpion)	MY83-1508-FB

To contact Aston Martin for further information about this document, please refer to the "Contact Us" page in Technical Hub.