

## **SSM 51437**

### **2020-2022 Escape/Corsair, 2021-2022 Bronco Sport, 2022 Maverick - Various Driver Assist Messages In The IPC - Built On Or Before 23-Mar-2022**

Some 2020-2022 Escape/Corsair, 2021-2022 Bronco Sport, 2022 Maverick vehicles built on or before 23-Mar-2022 may exhibit driver assistance warning messages displayed in the instrument panel cluster (IPC): Pre-collision Assist Not Available, Cruise Control Not Available, Collision Warning Malfunction and/or Adaptive Cruise Control Malfunction. Diagnostic trouble code (DTC) U0415:00 may also be stored in the power steering control module (PSCM), DTC C0051:67 stored in the anti-lock brake system (ABS) module and DTC U0418:86 stored in the image processing module A (IPMA). This may be due to the software in the PSCM. Using the latest version of Ford Diagnosis and Repair System (FDRS) scan tool, update the PSCM to the latest software level. For claiming, use causal part 3C529 and applicable labor operations in Section 10 of the Service Labor Time Standards (SLTS) Manual.