

ANB4 - Retrofitting Locking Caps on the Front Left and Right Headlights (Stop Delivery / Recall Campaign)

Revision: This bulletin replaces bulletin Boxster (986) Group 9 199/22 ANB4, dated January 6, 2023.

Model Year: **As of 2000 up to 2004**

Model Line: **Boxster (986)**

Country /
Market: **USA (C02)**
Canada (C36)

Concerns: **Locking caps in luggage compartment**

Cause: **There is a possibility that a locking cap that prevents the adjustment of the headlights in the horizontal direction was not installed on the affected vehicles during vehicle assembly. If this is the case, certain legal requirements will not be met in the USA and Canada markets.**

Action required: Check installation of the locking caps and retrofit a locking cap in the front luggage compartment on the left and right if necessary.



Information


Every vehicle is exactly **assigned just two campaign scopes**.

⇒ To find out which scope is assigned to the vehicle, see PCSS Vehicle Information.

Affected
Vehicles: Only vehicles assigned to the campaign (see also PCSS Vehicle Information).

Installation

Position:

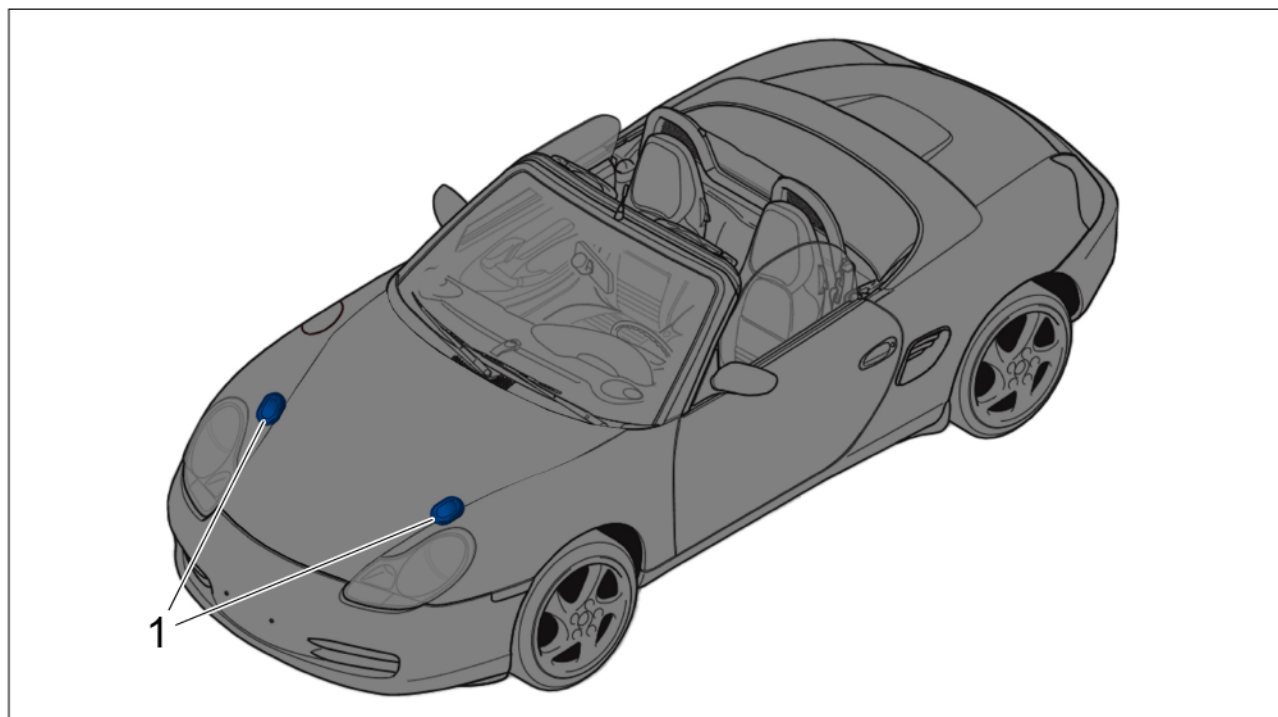*Installation position of cap***1** – Locking cap (retrofit)**Required parts**

Parts Info:

Required parts:


Part No.	Designation – Point of use	Quantity
V04015001KA	⇒ Plug – Headlight adjusting screws	2 pc(s)

Checking locking caps and retrofitting them if necessary


Work Procedure: 1 Open front lid.

2 Loosen carpet at the side by unscrewing plastic nut ⇒ *Loosening carpet at the sides -A, arrow-*.

- 3 Check that a locking cap is installed in the front luggage compartment on the left and right.
⇒ *Checking locking cap*

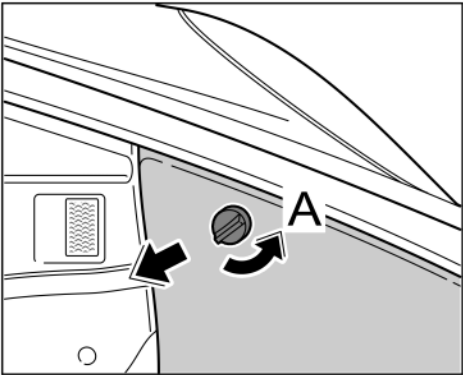

Loosening carpet at the sides

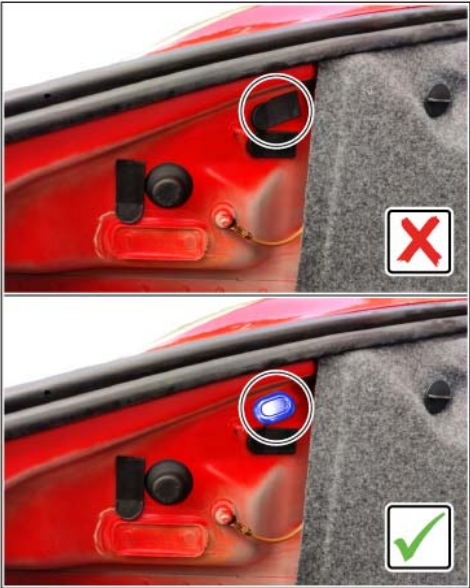

Checking locking cap

Assessment		Action
(✓)	A locking cap is installed in the front luggage compartment on the left and right.	End of remedial action. Continue with Step 5.
(✗)	There is no or only one locking cap installed in the front luggage compartment on the left and right.	Retrofit locking cap. Continue with Step 4.

- 4 Retrofit locking cap.


- 4.1 Remove old stopper ⇒ *Previous stopper -1-* in the front luggage compartment at the left and right.




Previous stopper

- 4.2 Press a locking cap ⇒ *Locking cap -2-* into the now existing opening in the front luggage compartment on the left and right until you hear a distinct click.

- 5 Secure the carpeting at the side tight with the plastic screw ⇒ *Fastening carpet at the sides -A-*.

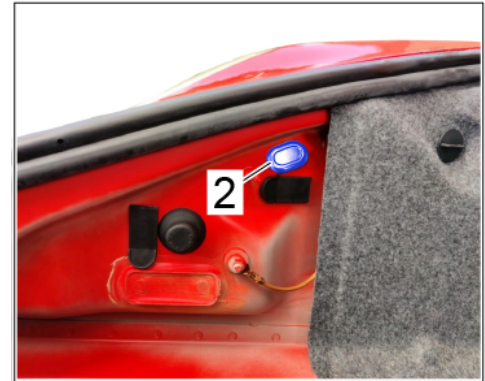

Locking cap

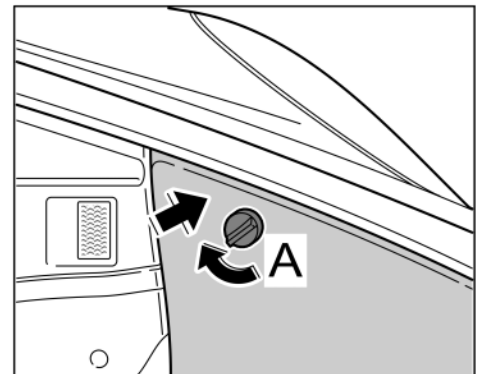

Fastening carpet at the sides

- 6 Close front lid.
- 7 Enter the campaign in the Warranty and Maintenance booklet.

Warranty processing



Information

The specified working time was determined specifically for carrying out this campaign and includes all necessary preliminary and subsequent work.

The working time may differ from the working times published in the Labor Operation List in the PCSS.

Scope 1 - 19: Not relevant for this vehicle type.

Scope 20: **Checking locking caps**

Labor time:

Checking locking caps

Labor time: **15 TU**

⇒ **Damage Code ANB4 099 000, Repair Code 1**

Scope 21: **Retrofitting locking caps**

Labor time:

Retrofitting locking caps

Labor time: **17 TU**

Includes: Checking locking caps

Parts required:

V04015001KA Plug

2 pc(s)

⇒ **Damage Code ANB4 099 000 1**

Important Notice: Technical Bulletins issued by Porsche Cars North America, Inc. are intended only for use by professional automotive technicians who have attended Porsche service training courses. They are written to inform those technicians of conditions that may occur on some Porsche vehicles, or to provide information that could assist in the proper servicing of a vehicle. Porsche special tools may be necessary in order to perform certain operations identified in these bulletins. Use of tools and procedures other than those Porsche recommends in these bulletins may be detrimental to the safe operation of your vehicle, and may endanger the people working on it. Properly trained Porsche technicians have the equipment, tools, safety instructions, and know-how to do the job properly and safely. Part numbers listed in these bulletins are for reference only. The work procedures updated electronically in the Porsche PIWIS diagnostic and testing device take precedence and, in the event of a discrepancy, the work procedures in the PIWIS Tester are the ones that must be followed.

© 2023 Porsche Cars North America, Inc.