

 Tesla, Inc. Service Bulletin		<i>Replace RH Body Controller Module To Enable Third-Row Seat USB Power</i>	
SB-23-17-003 March 24, 2023			
Classification		Section/Group	Mobile Service
Repair Bulletin		17 - Electrical	Can Perform (where permitted)
Model Year	Model	Country/Region	Build Location
2023	Model Y	North America	Fremont
The model(s) and model year(s) listed are a general approximation of the affected VIN list. Refer to the VIN/Bulletin Tracker or Customer/Vehicle profile to determine applicability of this bulletin for a particular vehicle.			

Repair Bulletin: This repair bulletin provides instructions on addressing a possible customer concern regarding the operation of Tesla vehicles. These instructions should only be performed by trained professionals.

Condition

Certain Model Y vehicles equipped with a seven-seat interior may require replacement of the RH body controller module to enable third-row seat USB power.

Correction

If this condition is present, replace the RH body controller module.

 **NOTE:** This bulletin applies only to the vehicles on the Affected Vehicle List (AVL). Do not perform this bulletin on other vehicles.

Correction Description	Correction	Time
SB-23-17-003 Not Applicable	S012317003	0.0
Replace RH Body Controller Module To Enable Third-Row Seat USB Power	S022317003	0.6

	Part Number	Description	Quantity
Parts Required	1657650-10-B	ASY. RIGHT CONTROLLER GEN 3, MY	1
	1116594-00-B	BOLT,EHS,M6X19,[88],ZN,SMAT,ADH	4


These part numbers were current at the time of publication. Use the revisions listed or later, unless otherwise specified in the [Parts Catalog](#).

Procedure

1. Remove the RH body controller module (refer to Service Manual procedure [17152202](#)).
2. Inspect the top center connector X050 of the replacement RH body controller module, and verify that it has a power pin at A32 (Figures 1 and 2).



NOTE: Do not install the new RH body controller module if pin A32 is missing.

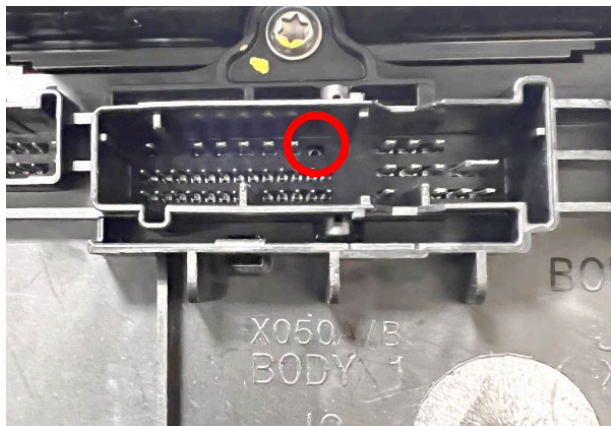

✗ Figure 1 – Connector X050 missing pin A32



✓ Figure 2 – Connector X050 with pin A32

3. Install the replacement RH body controller module (refer to Service Manual procedure [17152202](#)).
4. Verify that the third-row seat USB ports provide power.