



# Preliminary Information

**PIP5891D SES Lamp Illuminated with DTCs P30D4 P2B95 P02EE P02EF P02F0 P02F1 P02F2 P02F3 P02F4 P02F5 P2B08 P2B09 P2B0A P2B0B P2B0C P2B0D P2B0E P2B0F or P0201 - P0208 Active or Stored in History**

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Cadillac	Escalade	2022 - 2023	All	All	6.2L L87	All
Chevrolet	Corvette	2022 - 2023	All	All	6.2L LT2	All
Chevrolet	Silverado	2022 - 2023	All	All	5.3L L84, 6.2L L87	All
Chevrolet	Suburban	2022 - 2023	All	All	5.3L L84, 6.2L L87	All
Chevrolet	Tahoe	2022 - 2023	All	All	5.3L L84, 6.2L L87	All
GMC	Sierra	2022 - 2023	All	All	5.3L L84, 6.2L L87	All
GMC	Yukon	2022 - 2023	All	All	5.3L L84, 6.2L L87	All

Involved Region or Country	North America, Europe, Australia/New Zealand, Korea
Condition	<p>The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this bulletin. Some customers may comment that the SES lamp is illuminated or was illuminated and turned off. During inspection Technician may notice anyone of the following DTCs active or stored in history P30D4, P2B95, P02EE, P02EF, P02F0, P02F1, P02F2, P02F3, P02F4, P02F5, P2B08, P2B09, P2B0A, P2B0B, P2B0C, P2B0D, P2B0E P2B0F, P0201, P0202, P0203, P0204, P0205, P0206, P0207, P0208.</p>
Cause	This condition may be caused by a faulty fuel injector causing one of the DTCs to set.

**Correction:**

To determine if you have a faulty injector follow the diagnostic chart for applicable DTC to ensure there are no other concerns.

If diagnosis leads to no trouble found or a faulty injector, then proceed with injector replacement for the applicable cylinder and re-evaluate the vehicle.

Do not replace the ECM for this concern.

Engineering is aware of the concern and is currently investigating the root cause.

This PI will be updated as new information becomes available.

Parts Information



Description	Part Number	QTY.
Fuel Injector	Per EPC	1

### Warranty Information

For vehicles repaired under the Powertrain coverage, use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
4021200	Replace Fuel Injector	Use Published Labor Operation Time

### Version History

Version	5
Modified	<p>11/15/2022 - Created on.</p> <p>12/08/2022 - Updated to include Europe as an involved region.</p> <p>01/17/2023 - Updated to include DTCs P0201 - P0208.  </p> <p>01/25/2023 - Updated to include Australia/New Zealand as an involved region.</p> <p>03/03/2023 - Updated to add Korea region.</p>

