

Bulletin No.: PIP5776H Published date: 03/9/2023

Preliminary Information

PIP5776H Misfire Due To Collapsed Lifter

<u>Models</u>

Duranda	Model:		Model Years:	VIN:		Fracing	
Brand:				from	to	Engine:	Transmissions:
Cadillac	Escalade		2021	September 1, 2020	March 31, 2021	6.2 L87	All
Chevrolet	Silverado 1500		2020 - 2021	September 1, 2020	March 31, 2021	5.3 L84 6.2 L87	All
Chevrolet	Suburban		2021	September 1, 2020	March 31, 2021	5.3 L84 6.2 L87	All
Chevrolet	Tahoe		2021	September 1, 2020	March 31, 2021	5.3 L84 6.2 L87	All
GMC	Sierra 1500	Sierra 1500		September 1, 2020	March 31, 2021	5.3 L84 6.2 L87	All
GMC	Yukon	Yukon		September 1, 2020	March 31, 2021	5.3 L84 6.2 L87	All
Holden / GMSV	Silverado 1500 (4WD Only)		2020 - 2021	September 1, 2020	March 31, 2021	6.2 L87	All
Involved Region or Country N		North America, Middle East, Australia and New Zealand					
		The vehicle may come in with a P0300 - P0308 set with a bent push rod that leads to a Collapsed lifter or a lifter that come apart.					
Cause		Internal lifter concern.					

Correction:

If service information leads to a collapsed lifter and/or lifter has come apart including a bent pushrod it will be necessary to follow the replacement guideline below.

- If vehicle has under 16,000 miles (25,750km) and is within the breakpoint window it will be necessary to replace all lifters and guides on both banks.
- If vehicle has over 16,000 miles (25,750km) and is within the breakpoint window it will be necessary to replace the lifters and guides on the effected bank only not both.

Breakpoint for the models effected September 1, 2020 to March 31, 2021

When replacing the lifter and guide please indicated which lifter has failed by marking its location on the guide for inspection (please do not cover the date code). The parts will be requested back.

Note: It is not necessary to replace the oil control solenoid for this failure mode.

If the vehicle does not fall into the breakpoint window, please follow the latest version of 19-NA-218..

Australia and New Zealand Dealers – Please refer SEI-00000627 for further information.

Warranty Information

For this repair use the published labor time as called out in SI Labor Time Guide.

Version History

Version	9
	01/20/2021 - Created on.
	02/23/2021 - Added the Middle East
	03/04/2021 - Updated to clarify models.
	04/23/2021 - Update to change the correction statement
Modified	05/17/2021 - Update to add breakpoint and remove 2019 MY
	06/18/2021 - Updated to add repair information
	07/15/2021 - Updated to add regions.
	04/26/2022 - Updated to change mileage criteria
	03/09/2023 - Updated to add repair information



```
GENERAL MOTORS
```

© 2023 General Motors. All Rights Reserved.